

**INSTRUCTION MANUAL***cod. 80810 Edit. 10/2025 - ENG***ATTENTION!**

This manual is an integral part of the product, and must always be available to operators.

This manual must always accompany the product, including if it is transferred to another user.

Installation and/or maintenance workers MUST read this manual and scrupulously follow all of the instructions in it and in its attachments.

GEFRAN will not be liable for damage to persons and/or property, or to the product itself, if the following terms and conditions are disregarded.



The customer must respect trade secrets.

Therefore, this manual and its attachments may not be tampered with, changed, reproduced, or transferred to third parties without **GEFRAN's** authorization.

INDEX

Gefran Smart HART series READY-TO-USE GUIDE	4
<i>READY-TO-USE Using magnetic pen / pin CAL feature</i>	<i>4</i>
<i>READY-TO-USE Using HART Communicator</i>	<i>4</i>
<i>Menu Tree ➔ H Pres Transmitter.....</i>	<i>5</i>
1. General Information	6
2. Acronyms	6
3. Name coding	7
4. Sensor Technical Specifications.....	8
4.1. <i>HWJ – Technical data</i>	<i>8</i>
4.2. <i>HMJ – Technical data.....</i>	<i>9</i>
5. Mechanical Dimensions.....	10
6. Installation and positioning on the machine	10
6.1. <i>Installation seat.....</i>	<i>10</i>
6.2. <i>Drilling tool kit.....</i>	<i>11</i>
6.3. <i>Wiring and calibration</i>	<i>13</i>
7. Electrical Connections.....	14
8. Command modes	15
8.1. <i>Using Magnetic pen and Pin CAL.....</i>	<i>15</i>
8.2. <i>Using HART communication.....</i>	<i>17</i>
9. Maintenance.....	23
9.1. <i>Transport, storage and disposal.....</i>	<i>23</i>
10. Functional Safety notes (for SIL 2 / PL d certified versions only)	24
11. SAFETY NOTES FOR APPLICATIONS IN POTENTIALLY EXPLOSIVE ATMOSPHERES	29
11.1. <i>Nepsi Ex requirements.....</i>	<i>29</i>
11.2. <i>Mounting Instructions For Installations In Dangerous Zones</i>	<i>30</i>
12. ANNEXES	31

Gefran Smart HART series → READY-TO-USE GUIDE

This Ready-to-Use guide can be used by expert instrumentation operators to configure the transmitter using HART Communication or Autozero/Calibration features through magnetic pen or contacts on output connector.
For more full information please refer to the complete manual before operating.
The Ready-to-Use procedure with HART is intended for users already familiar with HART Communicator and loop powered equipment.

READY-TO-USE Using magnetic pen / pin CAL feature

Bring the system to the working temperature with the transmitter installed and connected to the measurement instrument without any pressure applied. For a 6 or 8 pin connector version, Pin A is Sig+/Exc+ and pin B is Sig-/Exc-.
For conduit output configurations, please look at Electrical Connections chapter.
Assure proper loop feeding voltage is applied to transmitter.

The measurement chain connected to the transmitter is calibrated as follows:


- 1) Reset the offset on the instrument by eliminating the thermal drift with the Autozero function.
With the sensor installed and the extruder at working temperature, wait until the temperature itself is stable, with a possible variation of $\pm 1^{\circ}\text{C}$. Consequently Autozero can be activated.
This allows to compensate all the signal drifts caused by tightening and temperature. Additional Autozero activations could be run once the temperature stability is reached, with $\pm 1^{\circ}\text{C}$ of possible variation.
- 2) Calibrate the instrument activating the CAL function.
The transducer brings its output to the calibration value shown on the transducer data plate (80% of full scale default, if changed with HART command it could be different). With the external Autozero function the calibration procedure is not feasible.
- 3) If the instrument does not exactly indicate zero, repeat points 1) and 2).

READY-TO-USE Using HART Communicator

Bring the system to the working temperature with the transmitter installed and connected to the measurement instrument without any pressure applied.

- 1) Connect Communicator to the loop. In case it's not sure on how to do this, please refer to "Connecting the HART Handheld Communicator" (Fig. 8.1).
- 2) Switch on HART Communicator. For reference please refer to HART Command tree on the following page.
- 3) From the main menu:
 - a. Enter Tag (Fast Key 1, 3, 1)
 - b. Set Pressure Units (Fast Key 1, 3, 3), if needed
 - c. Set URV (Fast Key 1, 3, 4) if output turndown (rescaling), is needed
 - d. Perform Autozero (Fast Key 1, 2, 6, 3, 1)
- 4) Check loop output is zero (4mA).
- 5) Remove HART Communicator from loop.

Menu Tree → H Pres Transmitter

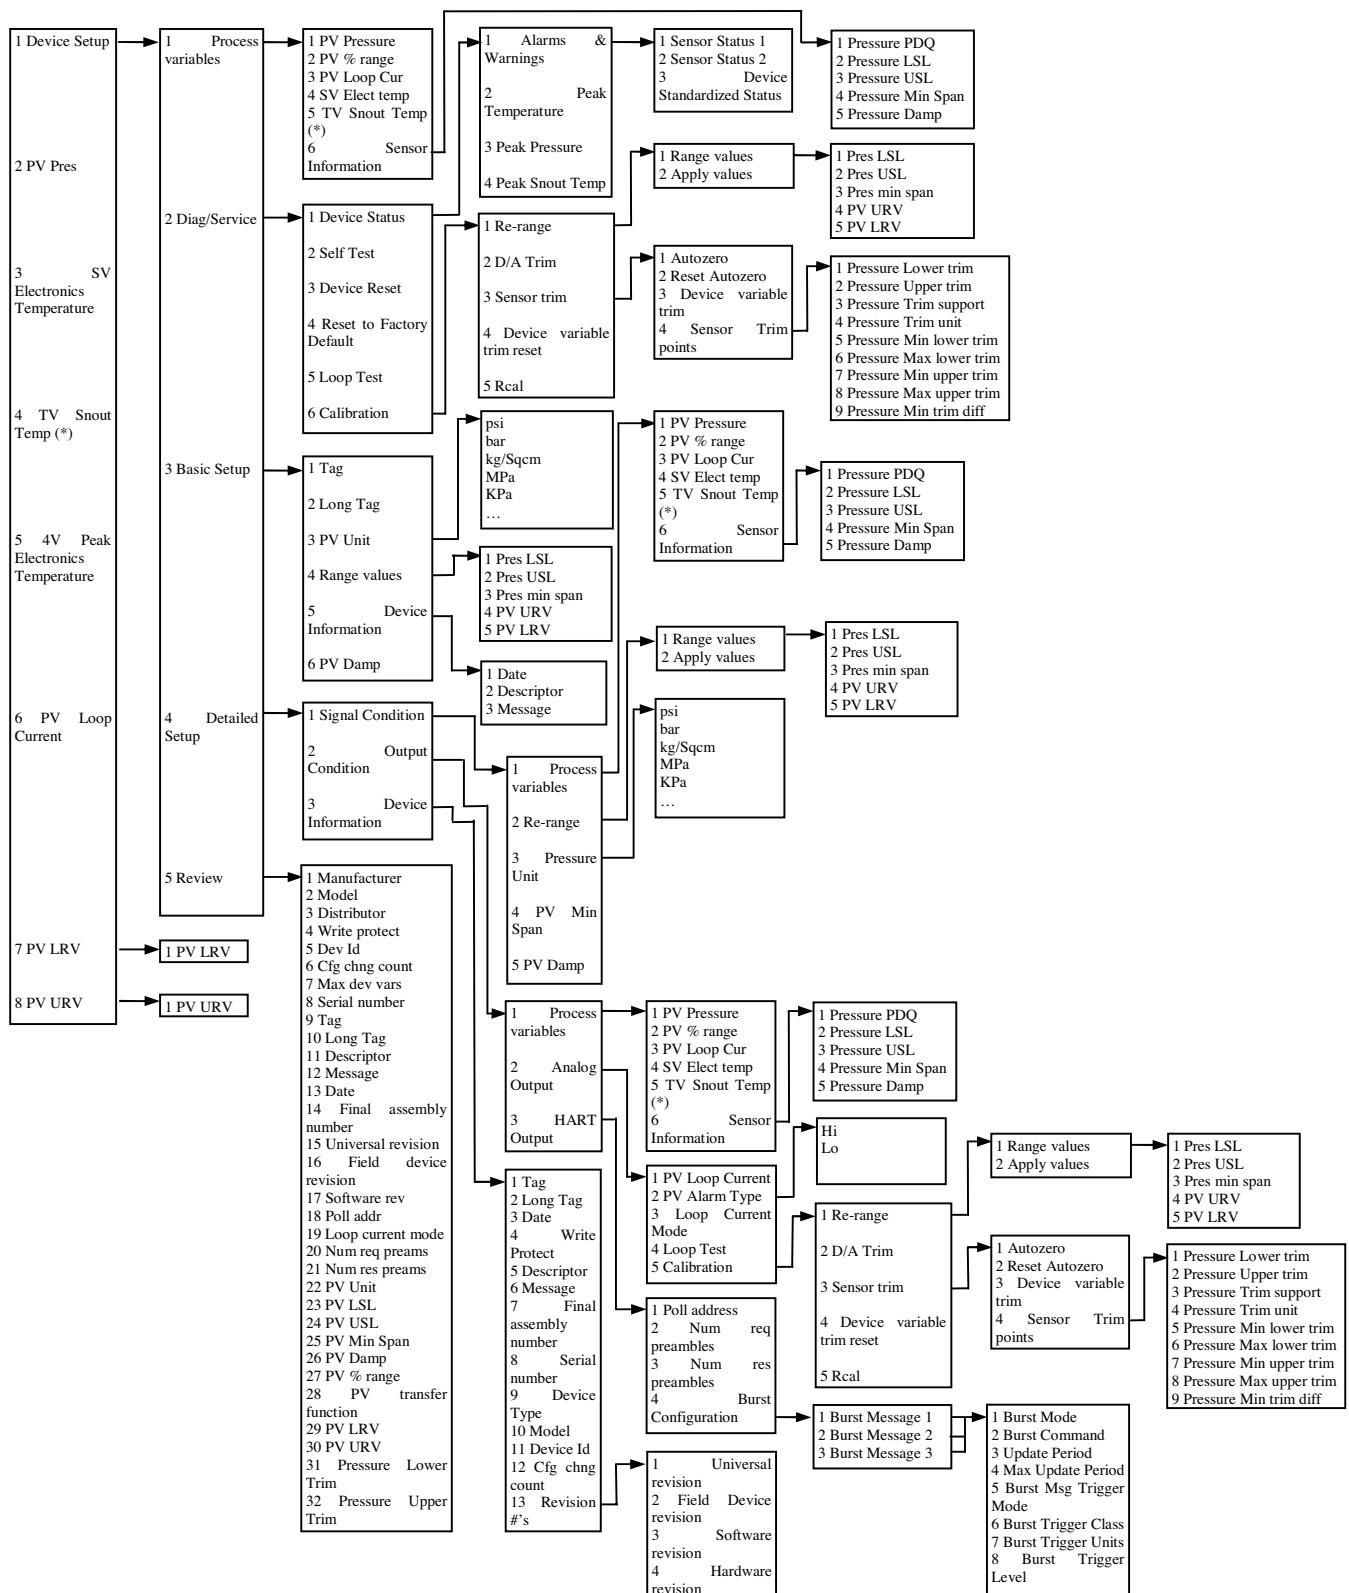

(*) Equal to 0 for HM, HW.

1. General Information

This manual applies to the following products:

HMJ and HWJ series produced by Gefran spa, via sebina 74 – 25050 Provaglio di Iseo - BS - Italy.

1.1 General information

This manual must be kept near the equipment for easy reading and consultation.

It must be read, understood, and strictly follow in order to avoid and prevent accidents and/or malfunctions.

Gefran will not be liable for any injury to people and/or damage to property deriving from disregard of this manual.

1.2 Copyright

Any reproduction of this document, even partial or for internal use, requires Gefran's approval.

1.3 Correct use

Gefran Melt pressure sensors with amplified current output with HART protocol are designed and built to measure the pressure and temperature variable of melted plastic at different temperatures according to the filling fluid used. The correct temperature range is:

- Up to 315°C for HW series (i.e. oil filling fluid)
- Up to 400°C for HM series (i.e. mercury filling fluid)

If the sensors are used as a safety component in compliance with the Machinery Directive, it's necessary to read carefully the "Safety Manual" (chapter 10).

In case the sensors are used for applications in potentially explosive atmospheres, please read carefully (chapter 11).

Installation and maintenance must only be carried out by suitably skilled and qualified personnel.

2. Acronyms

The following acronyms are frequently used:

BFSL	Best Fit Straight Line
DD	Device Descriptor
EEPROM	Electrically Erasable Programmable Read Only Memory
FS	Full Scale Output
HART	Highway Addressable Remote Transducer
LRV	Lower Range Value
PT	Pressure Transmitter
PV	Primary Variable (Pressure)
RTD	Resistance Temperature Detector (A very accurate temperature sensor)
SV	Secondary Variable (Electronics Temperature)
TV	Tertiary Variable (Snout Temperature)
URV	Upper Range Value
Watchdog	An internal timing control for the electronics

3. Name coding

HWJ	Hart Oil Filled Melt Pressure Transducer
HWJ P	Hart Oil Filled Melt Pressure Transducer PL d Certified
HWJ S	Hart Oil Filled Melt Pressure Transducer SIL 2 Certified
HMJ	Hart Mercury Filled Melt Pressure Transducer
HMJ P	Hart Mercury Filled Melt Pressure Transducer PL d Certified
HMJ S	Hart Mercury Filled Melt Pressure Transducer SIL 2 Certified

Gefran Melt sensors are pressure/temperature transmitters designed for use in high temperature environments. They read media pressure up to a temperature of 400°C, and resist such high temperatures thanks to their special mechanical construction, in which the measurement element is isolated from the Melt.

The constructive principle is based on hydraulic transmission of pressure; mechanical strain is transferred by means of a non-compressible transmission liquid.

The liquid used in these sensors may be mercury (i.e. HM series) or FDA-approved oil (i.e. HW series). Strain gauge technology translates the physical quantity (pressure) into an electrical signal.

Five different designs are available: rigid rod, flexible sheathing, flexible plus thermocouple, exposed tip and flange mount. Gefran Melt sensors satisfy all installation and field requirements.

The sensors can read an extremely wide range of pressures: from a version with minimum range of 0-17 bar up to a version with a scale of 0-1000 bar.

All models in the catalog can be supplied in two different classes of accuracy: class M, with accuracy of 0.5% FS, and class H, with accuracy of 0.25% FS. For all the other details and technical features please keep as reference the product datasheets or Gefran website www.gefran.com.

Performance Level 'd' or SIL2 certified versions are available.

IECEx/ATEX/NEPSI EX approved versions are available: rigid rod (0), flexible sheathing (1), flexible with thermocouple (2), exposed tip (3), flange mount (4). See chapter 11 on page 29 for specific marking depending on the model.

4. Sensor Technical Specifications

4.1. HWJ – Technical data

Accuracy (1)	H <±0.25%FS (100...1000 bar) M <±0.5%FS (17...1000 bar)
Resolution	16 bit
Measurement range	0..17 to 0..1000bar 0.250 to 0..15000psi
Rangeability	3:1
Maximum overpressure (without degrading performances)	2 x FS 1.5 x FS above 500bar/7500psi
Measurement principle	Extensimetric
Power supply	13...30Vdc
Maximum current absorption	23mA
Output signal Full Scale (FS)	20mA
Zero balance (tolerance $\pm 0.25\%$ FS)	4mA
Calibration signal	80% FS
Power supply polarity reverse protection	Yes
Compensed temperature range housing	0...+85°C
Operating temperature range housing	-30...+85°C
Storage temperature range housing	-40...+125°C
Thermal drift in compensated range: Zero / Calibration / Sensibility	< 0.02% FS/°C
Diaphragm maximum temperature	315°C / 600°F
Zero drift due to change in process temperature (zero)	< 0.04 bar/°C
Standard material in contact with process medium	Diaphragm: • 17-7 PH corrugated diaphragm with GTP+ coating Stem: • 17-4 PH
Protection degree	IP67
Electromagnetic compatibility – Emissions	EN 61326-1 EN 61326-2-3 EN 61326-3-1
Electromagnetic compatibility – Immunity	EN 61326-1 EN 61326-2-3 EN 61326-3-1

FS = Full scale output


(1) BFSL method (Best Fit Straight Line): includes combined effects of Non-Linearity, Hysteresis and Repeatability.

4.2. HMJ – Technical data

Accuracy (1)	H $\pm 0.25\%$ FS (100...1000 bar) M $\pm 0.5\%$ FS (17...1000 bar)
Resolution	16 bit
Measurement range	0..17 to 0..1000bar 0.250 to 0..15000psi
Rangeability	3:1
Maximum overpressure (without degrading performances)	2 x FS 1.5 x FS above 1000bar/15000psi
Measurement principle	Extensimetric
Power supply	13...30Vdc
Maximum current absorption	23mA
Output signal Full Scale (FS)	20mA
Zero balance (tolerance $\pm 0.25\%$ FS)	4mA
Calibration signal	80% FS
Power supply polarity reverse protection	Yes
Compensated temperature range housing	0...+85°C
Operating temperature range housing	-30...+85°C
Storage temperature range housing	-40...+125°C
Thermal drift in compensated range: Zero / Calibration / Sensibility	< 0.02% FS/°C
Diaphragm maximum temperature	400°C / 750°F
Zero drift due to change in process temperature (zero)	< 0.02 bar/°C
Standard material in contact with process medium	Diaphragm: • 15-5 PH with GTP+ coating • 17-7 PH corrugated diaphragm with GTP+ coating for ranges <100 bar (1500psi) Stem: • 17-4 PH
Protection degree	IP67 / NEMA 4X
Electromagnetic compatibility – Emissions	EN 61326-1 EN 61326-2-3 EN 61326-3-1
Electromagnetic compatibility – Immunity	EN 61326-1 EN 61326-2-3 EN 61326-3-1

FS = Full scale output
(1) BFSL method (Best Fit Straight Line): includes combined effects of Non-Linearity, Hysteresis and Repeatability.

Sense resistor Load Line

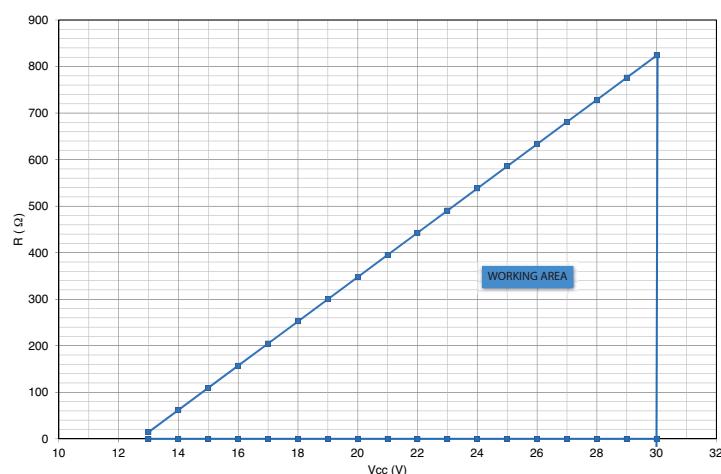

250 ohm minimum for HART communication

Sensors are manufactured in compliance with:

- EMC compatibility directive
- ATEX Directive and Ex Scheme (see chapter 11 on page 29)

Electrical installation requirements and Conformity certificate are available on our web site: www.gefran.com

5. Mechanical Dimensions

For the mechanical dimensions please keep as reference the product datasheets or Gefran website www.gefran.com

6. Installation and positioning on the machine

TECHNICAL DATA

Extrusion processes require very high temperatures. Extrusion pressure can be checked by means of especially designed transducers. Thanks to their special mechanical construction, in which the measurement element is isolated from the Melt, they resist to such high temperatures. The constructive principle is based on hydraulic of pressure; mechanical strain is transferred by means of a non-compressible transmission liquid.

Strain gauge technology translates the physical quantity (pressure) into an electrical signal.

Following advice for extending the sensors lifetime.

a) Avoid shocks and abrasions to the in contact diaphragm. Protect the transducer with its cover each time you remove it from its seat.

b) The seat must be prepared perfectly and with appropriate tools in order to respect the depth and axiality of the holes and tapping.

Pay particular attention to the coaxiality of the holes to the thread, because diaxialities greater than 0.2 mm will break the transducer during assembly. It is essential that hole depth guarantees the absence of chambers or air pockets in which extrusion material may be trapped.

To prevent contact with the extrusion screw or with tools used to clean the extrusion chamber, the front diaphragm must not extend from the inner wall of the extruder.

c) Before assembling the transducer in machines already in operation, make sure that the housing is clean. Remove any residual with the suitable cleaning device.


d) The transducer should be removed only with the machine empty (without pressure) but still hot.

e) The transducer should be cleaned with solvents for the material being processed.

Any mechanical action on the contact diaphragm modifies its operation and could break it.

6.1. Installation seat

The installation seat has to be realized:

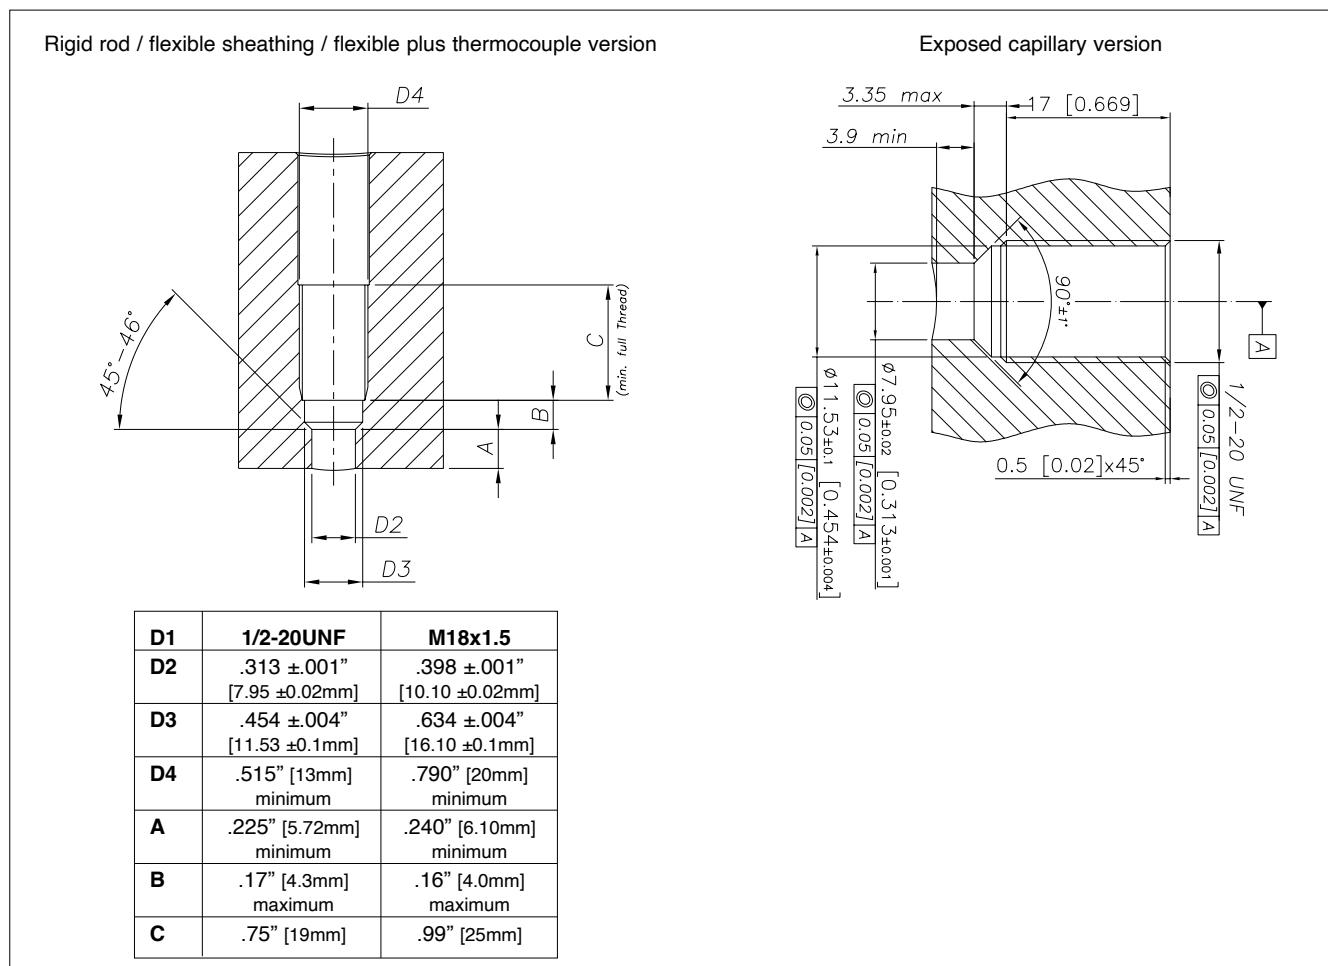



Incorrect working or shape of the side can result in properties out of specification, bad behaviour or damage to the sensor.

The side should be clean and without any polymer residual.

Drilling kit

A drilling kit with formed tools for drilling, reaming and tapping is available to facilitate correct preparation of the assembly seat. The assembly seat must be perfect to assure proper transducer function and long lifetime. Drilling kits are available in the following versions: **KF12, KF18**.

Drilling procedure

- 1) To drill hole (D4) up to a distance from the hole equal to the sum of (A+B+C) (tool 3).
- 2) Make the pass through hole (D2) by the tool 1.
- 3) To create the seal seat at a distance from the hole equal to dimension (A) (tool 4).
- 4) With a roughing tap, create threading 1/2-20UNF-2B (recognizable from the greater number of threads beveled at the mouth) (tool 5).
- 5) With a finishing tap, go over threading 1/2-20UNF-2B up to a distance from the bottom equal to the sum of (A+B) (tool 6).
- 6) To ream the hole (D2) with reamer (tool 2).

Installation seat check

The dimensions of the assembly seat have to be checked after preparation and before the transducer installation.

Use dummy plug SC 12/18 as follows:


- 1) Coat the end of the rod with the appropriate ink.
- 2) Lubricate the threaded part to prevent friction.
- 3) Insert the dummy plug and screw it fully down.
- 4) Remove the rod and examine it.

With the exception of 45° surfaces, the ink should be intact on the entire surface.


6.2. Drilling tool kit

VERSION CODE	KF12	KF18
THREADING TYPE	1/2-20UNF-2B	M18x1.5
1	Ø 7.6	Ø 9.75
2	Ø 7.95	Ø 10.1
3	Ø 13	Ø 20
4	Ø 11.5 with pilot guide	Ø 16 with pilot guide
5	1/2-20UNF-2B roughing	M18x1.5 roughing
6	1/2-20UNF-2B finishing	M18x1.5 finishing

CORRECT INSTALLATION

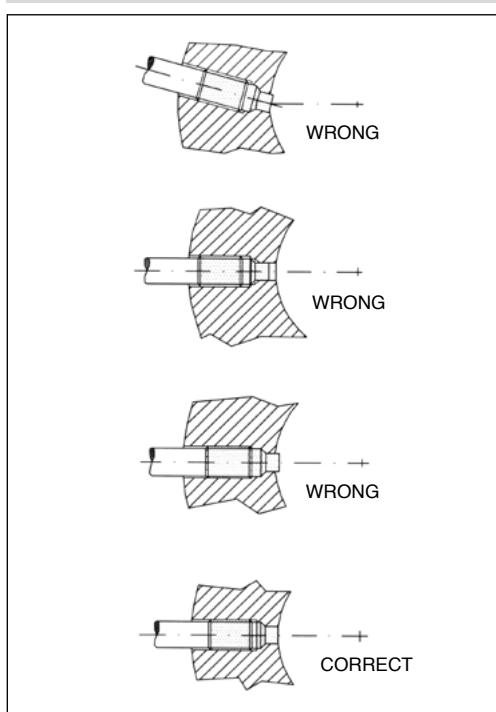

CORRECT SEAL

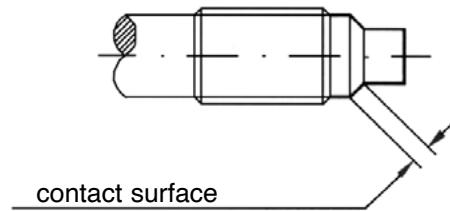

TRANSDUCER INSTALLATION

Installation procedure

- 1) Make sure the drilling procedure has been realized correctly. If the sensor is installed in a previously used hole, make sure the hole is completely clean and free of any plastic residual.
- 2) Remove the protective cap from the sensor tip.
- 3) Lubricate the thread with non-grip grease such as Neverseez (Bostik), or C5A (Felpro), or equivalent.
- 4) Insert firmly the sensor into the hole, first by hand and then with a wrench, 1/4 turn at a time.

Recommended torque: 50 Nm, the maximum is 56.5 Nm.

Removal (Fig. 6.1.)

To remove the transducer from its seat and carry on the working process, dummy plugs with identical mechanical dimensions are available.

The dummy plugs differ by type of threading; max pressure range is 2000 bar for all rods.

The dummy plugs are available in the following versions: **SC12 1/2-20UNF** seat - **SC18 M18x1,5** seat.

Brackets (Fig. 6.2.)

Models with flexible sheaths require the housing precise fixing. Suitable fastening brackets (SF18) are recommended.

Remember that the fastening point must be vibration-free (vibrations affect the measurement) and that temperatures must not exceed the maximum temperature range for the strain gauge housing (as stated on the sensor technical sheet).

Extruder starting

Bring the system to working temperature with the transducer installed and without any pressure applied. Wait until all the material is at the same temperature to prevent the transducer damage by semi-solid material.

Seat cleaning & Cleaning tool

As mentioned in the notes, the seat must be cleaned before the transducer installation.

The cleaning tool is a hard metal cutting tool specially designed to remove working materials residuals.

Recommended procedure (Fig. 6.3.)

The following procedure must be implemented with the material in a fluid condition.

- 1) Insert the tool in the seat and screw down the cutting rod (normally a 1/4 turn at a time).
- 2) Turn the pilot cutter clockwise until there is no resistance to cutting.
- 3) Repeat the procedure until the seat is completely clean.

For constructive reasons, the maximum torque applicable to the cutter is 15 Nm (1.5 Kgm).

If the hole occlusion requires higher torque for removal, use the drilling kit and follow the recommended procedure.

The cleaning tool is available in the following versions: **CT12 1/2-20UNF** seat - **CT18 M18x1,5** seat.



Fig. 6.1.



Fig. 6.2.

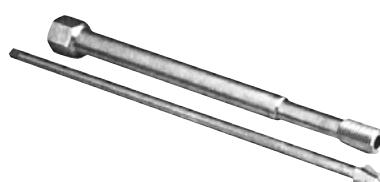


Fig. 6.3.

MOUNTING BRACKET	SF 18	
CLEANING TOOL KIT	CT	
1/2-20UNF	12	
M18x1,5	18	
DUMMY PLUG	SC	
1/2-20UNF	12	
M18x1,5	18	
DRILL KIT	KF	
1/2-20UNF	12	
M18x1,5	18	

6.3. Wiring and calibration

Connections

The sensors have to be connected as shown in the diagram at chapter 7.

To obtain a higher immunity from field noise, connect the cable shield to the female connector case on sensor side.

Calibration procedure using the magnetic pen/Pin CAL

Bring the system to the working temperature with the transmitter installed and connected to the measurement instrument without any pressure applied.

The measurement chain connected to the transmitter is calibrated as follows:

- 1) To reset the offset on the instrument by eliminating the thermal drift with the autozero function.
With the sensor installed and the extruder at working temperature, wait until the temperature itself is stable, with a possible variation of $\pm 1^{\circ}\text{C}$. Consequently Autozero can be activated.
This allows to compensate all the signal drifts caused by tightening and temperature.
Additional Autozero activations could be run once the temperature stability is reached, with $\pm 1^{\circ}\text{C}$ of possible variation.
- 2) Calibrate the instrument activating the CAL function. The transducer brings its output to the calibration value shown on the transducer data plate (80% of full scale default, if changed with HART command it could be different).
With the external Autozero function the calibration procedure is not feasible.
- 3) If the instrument does not exactly indicate zero, repeat points 1) and 2).
In this way, the instrument is calibrated to give the exact indication in the chosen engineering unit.

Calibration procedure using HART communication

Bring the system to the working temperature with the transmitter installed and connected to the measurement instrument without any pressure applied.

- 1) Connect Communicator to the loop. In case it's not sure on how to do this, please refer to "Connecting the HART Handheld Communicator" (Fig. 8.1).
- 2) Switch on HART Communicator. Please refer to HART Command tree on Ready-to-Use guide.
- 3) From the Main Menu:
 - a. Enter Tag (Fast Key 1, 3, 1)
 - b. Set Pressure Units (Fast Key 1, 3, 3), if needed
 - c. Set URV (Fast Key 1, 3, 4) if output turndown (rescaling), is needed
 - d. Perform Autozero (Fast Key 1, 2, 6, 3, 1)
- 4) Check loop output is zero (4mA).
- 5) Remove HART Communicator from loop.


7. Electrical Connections

The interface to controller is:

- a multi-polar cable outlet with conduit output type 1/2 14-NPT as illustrated in Fig. 7.1..

where are also pointed out the connections (2 wires connection current amplified). In the case of relay output with retransmitted output in current (2 wires) the connections are shown in Fig. 7.2.

CURRENT OUTPUT (NO RELAY)

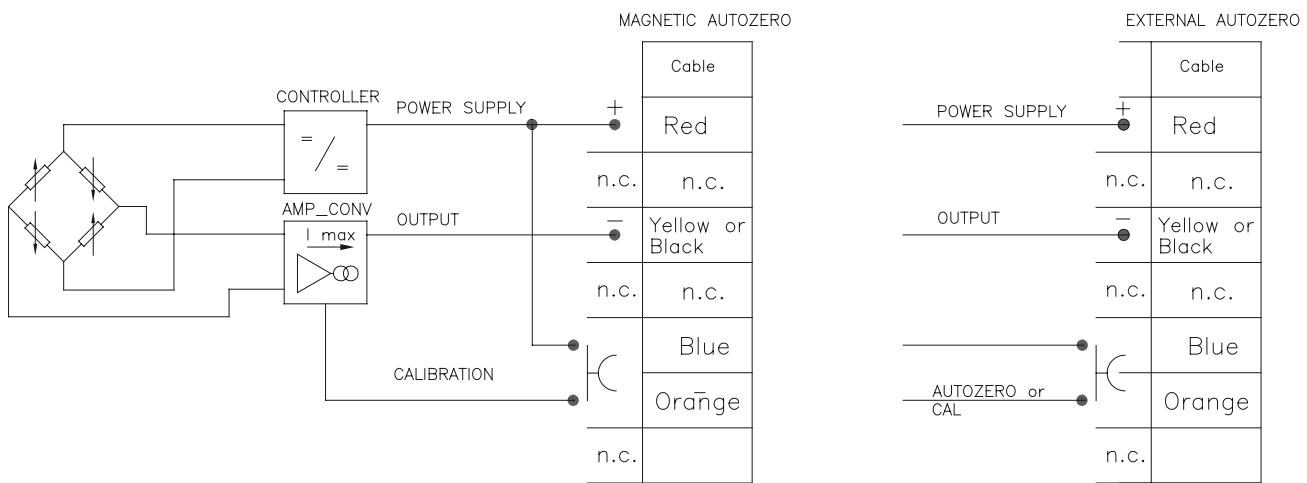

The cable shield is tied to both sides, i.e. to the sensor connector and to the controller

Fig. 7.1.

Cable outlet (1/2 14-NPT) L = 1 m

Current output

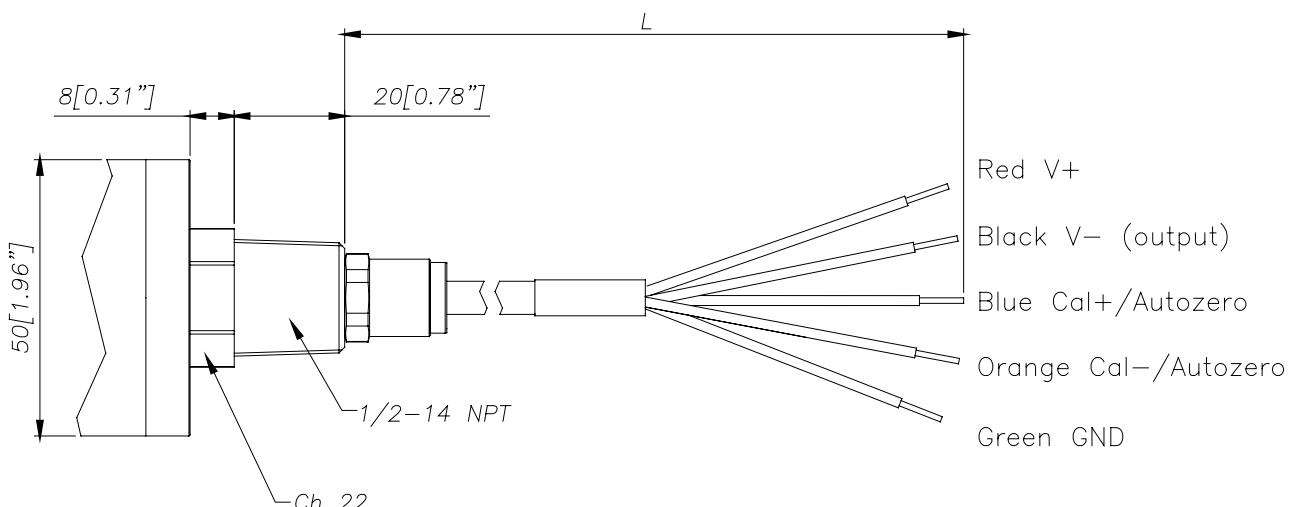


Fig. 7.2.

8. Command modes

The command modes must be used by the user only to make periodical recalibrations of the system in the process, and are made through:

- Magnetic sensor/Pin CAL
- HART Communication

8.1. Using Magnetic pen and Pin CAL


The event combinations give the following functions:

1. Autozero
2. Calibration (CAL)
3. Reset autozero


1) AUTOZERO

<i>Application mode</i>	<i>Limits</i>		<i>Result</i>
	<i>FS (bar)</i>	<i>% adjustment</i>	
The Autozero function is activated by : 1) positioning the magnet near the Autozero label on the shell of the sensor. 2) Short-circuiting the pin E-F (external Autozero version).	≤ 35	100	The Autozero effect will be visible after waiting 2 seconds starting from the function removal.
	$> 35, < 100$	40	
	$> 100, < 200$	20	
	≥ 200	10	The precision of the zero value will be defined by the accuracy class of the sensor.
The magnet has to be maintained on the Autozero position for a time within 2 to 5 seconds.			

NOTE: For all transmitters with current outputs, during the Autozero phase, output can rise up to 7 mA.
That's a short variation only visible during the Autozero phase; it won't have any effects on the final signal.

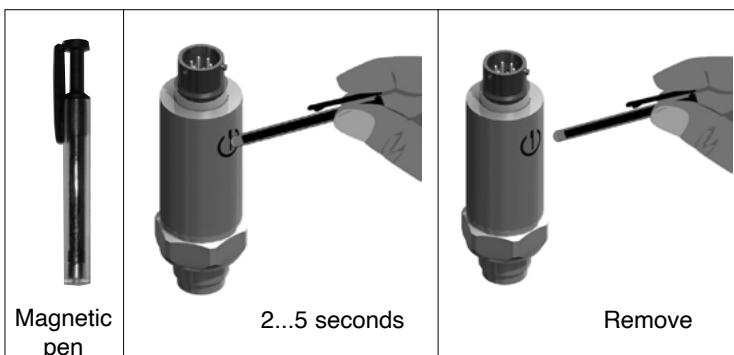

 - 1) Machine pressure = 0 bar and transducer powered.
- 2) Put magnetic pen on marked spot (2...5 seconds).
- 3) Remove magnetic pen.
- 4) Ready !



= marked spot



Warning: the periodical zero ricalibration through the Autozero function must be done at stable temperature and no pressure in the extrusion chamber.

2) CALIBRATION (CAL)

Application mode	Limits	Result
Start CAL: The Calibration function is activated by short-circuiting the pin E – F for a minimum time of 1 second.	The whole Zero unbalance in comparison to the zero done by the manufacturer, has to be $\pm 20\%$ FS.	During the Calibration phase the signal will be unbalanced to the 80% FS. The calibration effect is visible 2 seconds after short-circuiting E - F.
Stop CAL: Release the E - F short-circuit.		The Calibration function doesn't work outside the defined limits..
NOTE:		
The Calibration function is not allowed for “external Autozero” version.		

3) TOTAL RESET OF THE CALIBRATION VALUES

Application mode	Limits	Result
The magnet has to be maintained on the Autozero position for a time of 20 to 25 seconds.		The Zero and Span of the transmitter will be recalibrated to the factory settings.
NOTE:		
In the current transducers output value, when applying the magnet can see an imbalance of the output signal up to 7mA.		

During HART Handheld Communicator connection

In case of hazardous areas please refer to the handheld communicator user manual for instructions for using HART Communicator correctly.

Please consider a minimum of 250 Ohm resistance has to be present in the loop. The loop current is not measured directly by the HART Communicator.

Anywhere along the 4-20 mA wire the HART Communicator can interface with the device.

Please see the picture below (Fig. 8.1).

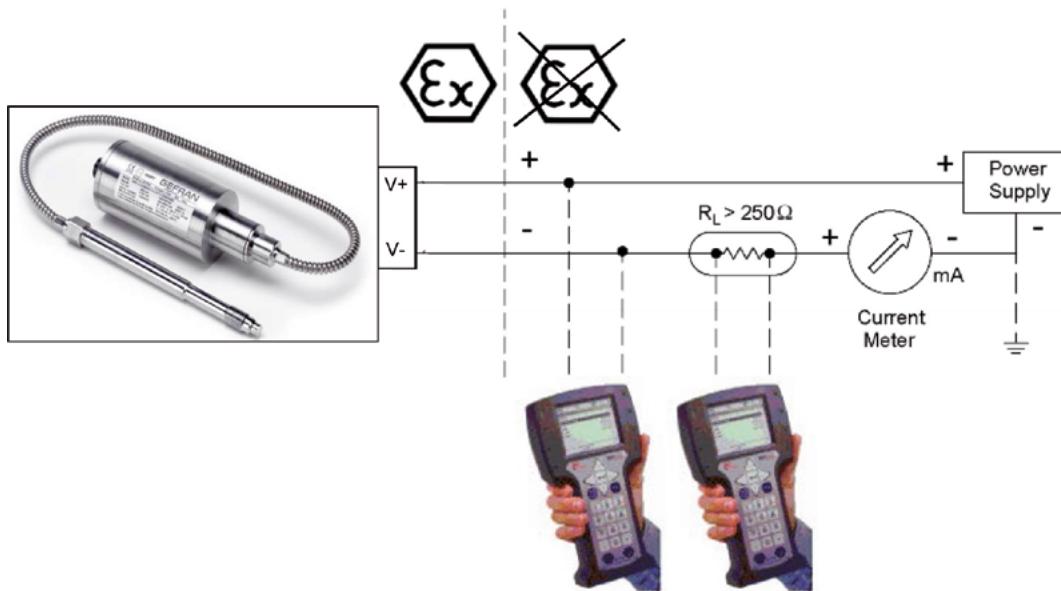


Fig. 8.1. Hart Handheld Communicator Interface

Procedure

1. Connect Power Supply and HART Communicator as in the above drawing.
2. In case of commissioning on the bench with a dead weight tester or with a calibrated pressure generator, please check pressure connection is not leaking.
3. Apply power to the transmitter and switch on the HART Communicator by pressing using the ON/OFF key. The HART Communicator LCD display should show H Pressure Transmitter in the upper left corner. If this is not present, please refer to chapter 9. "Safety", Troubleshooting section.
4. Set PV Units (Fast Key 1, 3, 3) to proper pressure unit (e.g. bar, psi, kgf/cm², MPa, etc.).
5. Set Tag (Fast Key 1, 3, 1).
6. In case the transmitter output has to be re-ranged, fix the proper LRV (Fast Key 7,1) and URV (Fast Key 8, 1).

Note: URV can't be turned down below the PV Minimum span (Fast Key 1, 3, 4).

Attention: after modification of LRV and/or URV value/s, it's needed to verify that the parameterization process has been successfully concluded, through a reference of pressure at LRV and URV values.

7. Fix Lower Trim with device variable trim method (Fast Key 1, 2, 6, 3, 3).
8. Check transmitter output. Zero pressure output should read 4 mA.

Attention:

The following phases are not part of a standard system setup and should be carried out by qualified personnel only.

According to this please consider the transmitter is very steady and it's been accurately calibrated in our factory using precise pressure sources. Such a task should only be carried out using these type of devices.

9. By means of calibrated pressure generator, apply the same pressure already set in URV during step 6. Output should equal 20mA. In case output isn't 20 mA, please go to step 10.
10. In order to calibrate full scale output, please apply firstly pressure equal to full scale pressure. Then you can proceed to set Upper Trim value with Device Variable Trim method (fast key 1, 2, 6, 3, 3; anyhow please consider Lower Trim value has to be done). Now output should be the same of the full scale pressure.
11. When transmitter Output Damping is needed, please set PV Damping (fast key 1, 3, 6) to the proper value.
12. Press the left arrow key until the HART Communicator is off-line. Then switch off the power.

At this point the pressure transmitter can be installed in the process.

Autozero using HART communication

With the transmitter installed and connected to the measurement instrument without any pressure applied and with the system at the working temperature, once temperature itself is stable, i.e. with a possible variation of $\pm 1^{\circ}\text{C}$, Autozero can be performed. If the zero trim function is selected (fast key 1, 2, 6, 3, 1) the output will be modified to show zero pressure. Such a task is carried out by the transmitter electronics automatically by regulating digital PV to zero while analog output will be 4 mA.

Usually an Autozero is all that is needed once installation is completed as the transmitter span has been calibrated at the factory.

In case the Full Scale Output is not correct when tested with a calibrated pressure source or dead weight tester, the transmitter span can be regulated using the Device Variable Trim method (fast key 1, 2, 6, 3, 3).

Please apply Zero Pressure firstly and follow the prompts on the handheld HART Communicator. Once completed, please apply a known calibrated full scale pressure to the transmitter and follow the prompts on the handheld HART Communicator. Once completed, the digital PV will be corrected to full scale output.

Transmitter functions using HART communication (with fast key sequences)

Autozero (1, 2, 6, 3, 1)

Digital modification to zero: it affects both the digital and analog output. Please consider this operation is different from Lower Sensor Trim as Autozero has to be done ONLY at zero pressure.

Reset Autozero (1, 2, 6, 3, 2)

Reset Autozero correction.

Device Variable Trim (1, 2, 6, 3, 3)

Digital modification to zero and full scale: it affects both the digital and analog output.

Please consider this operation is different from Autozero as Lower Sensor Trim can be made at positive pressures, i.e. above zero.

Note: Such an operation has to be carried out with a known calibrated pressure source only.

D/A trim (1, 2, 6, 2)

This function is used to match the digital representation of the analog output with its real analog loop current.

Note: Such an operation should be carried out with a known calibrated current (mA) meter only.

Re-range

The 4mA and 20mA points, i.e. LRV and URV respectively, can be regulated in order to improve output resolution. This means a Re-range (also called "Turndown") ratio of 3:1 is possible.

Please consider accuracy data is reliant upon the Full Sensor Range without applying any turndown.

Note: In case pressure applied to the transmitter is not in the range of the 3:1 turndown ratio, the transmitter will refuse the command.

Such a condition will be shown by the output not adjusting to 20mA after a few requests.

LRV Rerange (7, 1)

This function is the pressure at which the transmitter will display a 4 mA output as entered directly by the operator. LRV variation affects the transmitter span so the range is restricted by the minimum span value found in fast key (1, 3, 4, 3).

URV Rerange (8, 1)

This is the pressure at which the transmitter will display a 20 mA output as entered directly by the operator. This range is restricted by the minimum span value found in fast key (1, 3, 4, 3).

LRV Rerange by applying a known pressure (1, 2, 6, 1, 2)

Such a function is performed by applying a known pressure and starting the procedure in order to set the 4mA point according to the pressure reference value.

Note: Such an operation should be carried out with a calibrated pressure source only.

URV Rerange by applying a known pressure (1, 2, 6, 1, 2)

Such a function is performed by applying a known pressure and starting the procedure in order to set the 20mA point according to the pressure reference value.

Note: Such an operation should be carried out with a calibrated pressure source only.

Device Variable Trim reset (1, 2, 6, 4)

This function is used to restore the Zero, Lower, and Upper Trim to the factory setting values.

R-Cal (1, 2, 6, 5)

Activating R-Cal, the output will be fixed to the percentage of span fixed by such function.


80% is default value.

Damping (1, 3, 6)

The damping time constant affects the speed with which the output signal reacts to changes in pressure as shown in the figure on the next page.

By default damping is off, but values between 0 and 30 seconds can be fixed using the handheld communicator. Only one decimal digit is allowed.

See also specific notes on response time in Functional Safety Notes (chapter 10)

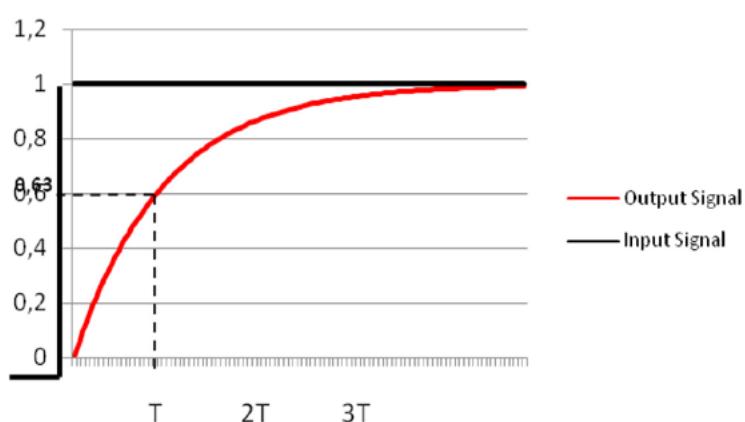

Status (1, 2, 1, 1)

Reads Device Status.

The status is shown in 3 bytes:

Standardized Device Status:

Bit	Function
0	Reserved
1	Non volatile memory failure
2	Not used
3	Watchdog reset executed
4	Voltage conditions out of range
5	Not used
6	Not used
7	Not used

Sensor Status 1:

Bit	Function
0	Input stage error
1	Sensor overrange
2	Sensor broken
3	Micro controller overheated
4	Error parameter
5	Voltage error
6	Watchdog error

Bit	Function
7	Cycle error

Sensor Status 2:

Bit	Function
0	Reserved
1	Sensor under range
2	Low loop voltage
3	Not used
4	Not used
5	Not used
6	Not used
7	Not used

PV Unit (1, 3, 3)

The PV unit sets the unit of measure that the pressure related parameters are transmitted. The transmitter can be configured using several engineering units such as psi, bar, MPa, and kgf/cm² and many others.

After setting a new pressure unit, all entries for pressure are converted to the new unit, using the following rules:

$$1 \text{ psi} = 0.068947 \text{ bar} = 0.0068947 \text{ MPa} = 0.070309 \text{ kgf/cm}^2$$

Tag (1, 3, 1)

An inventory “Tag” identification number may be stored in transmitter memory (8 characters maximum). Software tag is a single question mark by default.

Long Tag (1, 3, 2)

An inventory “Long Tag” string (32 byte) may be stored in transmitter memory.

Descriptor (1, 3, 5, 2)

For further transmitter description, e.g. location, function, position, etc., a 16 character text can be input.

Message (1, 3, 5, 3)

A 20 character message can be fixed and displayed on the Hart Communicator.

SV Electronics Temperature (1, 1, 4)

Electronics temperature, i.e. the temperature measured on the electronics housing, is used for reference and factory diagnostics only.

TV Snout Temperature (1, 1, 5)

Temperature measured on Transducer Snout, only for fluid-free models (HI), otherwise it equals to 0.

Poll Address (1, 4, 2, 3, 1)

Multidrop mode allows to have more than one transmitter (up to 15) on a single loop. When this value is different from zero, the transmitter is in Multidrop mode.

For instance a Multidrop mode would be a group of Hart devices wired in parallel on a single fed loop and each device being assigned a unique poll address (1-15).

The Hart communicator would prompt for the single transmitter address to communicate with and would poll that particular device only. All others would remain unvaried.

Burst configuration (1, 4, 2, 3, 4)

If the transmitter is used in Burst Mode, the sensor displays one-way digital communications from the transmitter to the host.

In this case communication speed is faster as the transmitter has not to be polled to send information. Data transmitted in Burst Mode include Pressure Variable, Analog Output value, pressure in percentage of range and Diagnostic Data.

Access to other information can still be obtained through normal Hart command.

Reset to factory default (1, 2, 4)

The transmitter factory settings (including zero and span) can be restored. The list of parameters restored is reported below:

1. Restore LRV and URV to their values at shipment.
2. Restore the Pressure Unit (bar, psi, etc.) to its value at shipment.
3. Set the Analog Output Alarm Level to Low.
4. Remove all Pressure Damping.
5. Clear all Sensor and Analog Output Trim values.
6. Clear Burst Mode.
7. Restore the Address to Zero.
8. Restore the R-Cal option to its value at shipment.

HART Communicator Fast Key Sequences

The Hart Communicator Fast Key sequences are reported in the following table. Please consider Fast Keys as shortcuts to rapidly moving through the menu tree.

HART Communicator Fast Key Sequences

Function	Fast Key Sequence
Read PV Pressure	1, 1, 1
Read % of Full Scale	1, 1, 2
Read Analog Output	1, 1, 3
Read SV Electronics Temperature	1, 1, 4
Read TV Snout Temperature	1, 1, 5
Read Peak Pressure Value	1, 2, 1, 3
Read Peak Temperature Value	1, 2, 1, 2
Read Sensor Diagnostic Status	1, 2, 1, 1
Read PV Minimum Span	1, 3, 4
Perform Sensor Self-Test	1, 2, 2
Perform Sensor Master Reset	1, 2, 3
Perform Loop Test	1, 2, 5
Perform D/A Trim	1, 2, 6, 2
Perform Autozero	1, 2, 6, 3, 1
Reset Autozero	1, 2, 6, 3, 2
Perform Device variable trim	1, 2, 6, 3, 3
Device variable trim reset	1, 2, 6, 4
Set Rcal	1, 2, 6, 5
Set Tag	1, 3, 1
Set Long Tag	1, 3, 2
Set PV Unit	1, 3, 3
Set Lower Range Value (LRV)	1, 3, 4, 5
Set Upper Range Value (URV)	1, 3, 4, 4
Display Lower Set Limit (LSL)	1, 3, 4, 1
Display Upper Set Limit (USL)	1, 3, 4, 2
Set Date	1, 3, 5, 1
Set Descriptor	1, 3, 5, 2
Set Message	1, 3, 5, 3
Set PV Dampening	1, 3, 6
Set PV Analog Output Alarm Type	1, 4, 2, 2, 2
Set Poll Address	1, 4, 2, 3, 1
Set Burst Configuration	1, 4, 2, 3, 4

Alarm and Saturation values burst mode

No special requirements are defined for the burst mode.

Alarm and Saturation values in multidrop mode

If the device is in multidrop mode, the NAMUR levels are no longer achievable. Instead the fail safe condition is indicated by the field device status and by the additional diagnostics.

9. Maintenance



Installation and/or maintenance workers are responsible for installing, using and maintaining instruments according to safety regulations for the specific application.

Installation and/or maintenance workers must read this manual and scrupulously follow all of the instructions in it and in its attachments.

GEFRAN will not be liable for damage to persons and/or property, or to the product itself, if the following terms and conditions are disregarded.

In case of contact or inhalation of the fluid contained in the Melt sensor, follow the instructions on the toxicology sheet for the related substance (please refer to Annex 1 - Hg Toxicological sheet).

Further, HW series melt sensors, are totally compatible with the European Directive RoHS on the restriction of the use of certain hazardous substances in electrical and electronic equipment.

9.1. Transport, storage and disposal

Melt sensors are made with "Filled" technology and contain a pressure transmission fluid. Low-compression fluids such as diathermic oil (FDA and USDA approved), or mercury are used.

Fluid volumes depend on the mechanical structure of the sensor, and leaks can occur only if the contact diaphragm is broken. Any other type of break will not cause emission to the environment.

Never transport store the sensors without the protective cap and without the original packaging. In particular, as mercury is a hazardous material it must be disposed of in compliance with applicable law.

Gefran accepts its Melt sensors (defective or damaged by use) for disposal.

10. Functional Safety notes (for SIL 2 / PL d certified versions only)

Designated category and fail exclusions

The safety function of the transducer is the correct measure and transduction of the read pressure value, with generation of a current output signal (4...20mA) within specification written in the datasheet and in the current operating manual, for comparison with a fixed safety threshold - high threshold (comparison performed by external downstream controller)

The designated category to which are limited the use of safety related parts is Category 2.

The SIL/PL parameters of the transducer are shown in the table below:

Parameter	Value	Measuring Unit
Architecture	1oo1(D)	--
HFT	0	--
Category	2	--
β, β_D factors	0,02	--
λ_{DD} Analog output	7,50E-07	1/h
λ_{DU} Analog output	1,13E-07	1/h
DCavg Analog output	90	%
SFF Analog output	92,68	%
MTTFd Analog output	132	years
PFH Analog output	1,13E-07	1/h
Systematic capability	2	--
SIL	2	--
PL	d	--
Life time	20	years

Tab. 10.1.

In the evaluation three different failures have been excluded:

- Wearing/corrosion of the mechanical parts at the process front end [13849-2:2012 prospect A.4]
- Break of the mechanical parts at the process front end [13849-2:2012 prospect A.4]
- Plastic deformation due to excessive loads of the mechanical parts at the process front end [13849-2:2012 prospect A.4]

Effect on the safety function of the performance variations

The limit of performance degradation in order to avoid the loss of the safety function is $\pm 5\%$ of the span at room temperature.

SRP/CS interface and protection devices

The interface to controller can be:

- the multi-polar cable outlet with conduit output type $1/2$ 14-NPT as illustrated in Fig. 7.2, where are also pointed out the connections (2 wires connection current amplified).

Response time

The response time of the safety function is:

Analog out = 250 ms

The response time of safety function is considered with Damping filter = 0

The response time changes accordingly considering a Damping filter value other than 0, summing the value of Damping filter to 250ms

The response time in case of a detected fault is:

Analog out = 500 ms

The response time in case of a detected fault is not affected by Damping filter value

Suspension of the safety function

In H series transducer it's not allowed any suspension or bypass of the safety function.

Indications and alarms

The HMJ/HWJ series have an amplified 4...20mA analog electrical output

In Fig. 10.1 are shown the significant values of the outputs in case of analog signal:

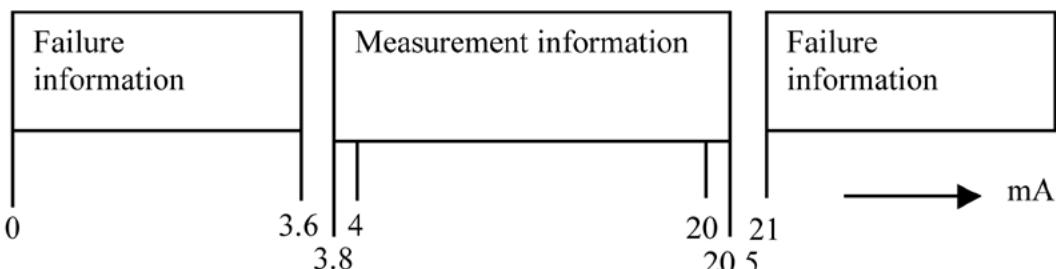


Fig. 10.1. Output levels

In Tab. 10.2 are pointed out the failures, their effects on the output signal and how to reset them (see Fig. 10.1 for analog output levels):

Failure	Analog output	How to reset
Supply wire broken	LOW	Remove failure
Sensor unconnected	LOW	Remove failure
Supply system broken	LOW	Remove failure
Broken primary element	HIGH	Send sensor to factory for repair
Broken chip	HIGH	Send sensor to factory for repair
Pin detachment	HIGH	Send sensor to factory for repair

Failure	Analog output	How to reset
Pressure over 200% of the span vs factory zero @ RT	HIGH	Switch off and on; if error persists send to factory for repair
Preload loss exceeds -30 % of span vs factory zero @ RT	HIGH	Switch off and on; if error persists send to factory for repair
Primary or front end stage error	HIGH	Switch off and on; if error persists send to factory for repair
Overvoltage	LOW (*)	Switch off and on; if error persists send to factory for repair
Undervoltage	LOW (*)	Switch off and on; if error persists send to factory for repair
Program sequence error	LOW (*)	Switch off and on; if error persists send to factory for repair
Overtemperature on electronics	LOW (*)	Switch off and on; if error persists send to factory for repair
Error in RAM memory	LOW	Switch off and on; if error persists send to factory for repair
Error in ROM memory	LOW	Switch off and on; if error persists send to factory for repair
Error in CPU	LOW	Switch off and on; if error persists send to factory for repair
Analog output error	LOW	Switch off and on; if error persists send to factory for repair

Tab. 10.2. - Failures, effect on electrical output and reset

(*) In such conditions the Alarm Type can be programmed via HART at HIGH.

The HMJ P/S and HWJ P/S series are fully compatible with the NE21 and NE43 Namur recommendations.

In the H series melt sensors, no hardware feedback have been implemented.

Alarm and Saturation values burst mode

No special requirements are defined for the burst mode.

Alarm and Saturation values in multidrop mode

If the device is in multidrop mode, the NAMUR levels are no longer achievable. Instead the fail safe condition is indicated by the field device status and by the additional diagnostics.

Mainteinance and troubleshooting

To maintain the device in the designated category it must be used only by skilled people and strictly following the present safety instructions and the operating manual regarding the mechanical installation, the electrical connection, the maximum rated and environmental conditions.

Visual inspection of the process front end membrane and of the pitch of the thread

The activity evaluates abnormal abrasion or wearing due to uncorrect mounting or by aggressive process materials. The thread pitch inspection must assure the sensor integrity to avoid fluid outcoming from the extrusion chamber or poor sealing of the sensor mounted in its side.

Periodicity: every 1 year.

Installation hole check

The activity evaluates the hole profile and dimensions in order to avoid failures or sensor bad functioning.

Periodicity: every 2 years.

Sensor calibration check

The activity evaluates the sensor transduction characteristic curve. This is implemented by applying known pressure and checking the output detected values.

Periodicity: every 2 years.

Pressure channel occlusion check

The activity evaluates the presence of eventual occlusions of the pressure channel which will lead to improper functioning. At any new installation or re-installation use anti-seize compound paste in order to avoid grip of the thread.

Periodicity: it is good practice to make the control whenever any variation of the operating conditions occurs, i.e. variation related to the material and/or the temperature, which can cause pressure channel occlusions.

Command modes check

The activity evaluates the proper functioning of the command modes and their effects on the sensor. This is implemented by feeding the sensor out of the line and performing the following operations: RESET AUTOZERO, AUTOZERO, CALIBRATION.

Periodicity: every 2 years.

In the Tab. 10.3 the most common failures and troubleshooting are pointed out:

Failure	Possible causes	Troubleshooting
The sensor doesn't signal pressure and no alarm signal is activated	<ul style="list-style-type: none"> • Pressure channel occlusion • Output stage failure • Over Pressure from 106,5% to 200% of span (HM/HW) 	<ul style="list-style-type: none"> 1 - Sensor power-off and disassembly 2 - Double check possible pressure channel occlusion and clean it from residuals or material 3 - Do the AUTOZERO function. If the problem persists, send the sensor to factory for repair 4 - Reduce the process pressure under the F.S. value 5 - Switch on the sensor off-line and slightly press with the finger the membrane; if the output signal is stable, send it for factory reparation
The sensor alarm signal is "HIGH"	<ul style="list-style-type: none"> • Broken primary element • Input stage error • Detected pressure value over threshold (2 x FS) 	<ul style="list-style-type: none"> 1 - Sensor power-off and disassembly 2 - If the problem persists, send the sensor to factory for repair
The sensor alarm signal is "LOW"	<ul style="list-style-type: none"> • Cut cable / broken connector • Device not connected • Broken supply • Overvoltage • Undervoltage • Floating power supply • Program sequence error • Overtemperature on electronics • Pin detachment 	<ul style="list-style-type: none"> 1 - Sensor power-off and disassembly 2 - Check the correct connection of power supply 3 - Check the electrical continuity between the female plug and the power supply 4 - Check if the power supply level is within specifications 5 - Check voltage supply stability 6 - Check possible housing overtemperatures Remove the reasons, wait till cooling down and switch on the sensor 7 - If the problem persists, send the sensor to factory for repair 8 - If the sensor works fine, mount the sensor in the seat following instruction manual
The CAL function doesn't work	<ul style="list-style-type: none"> • Broken electronics • Zero signal threshold out of range • Broken connector/cut cable 	<ul style="list-style-type: none"> 1 - Stop the machine 2 - Make the TOTAL RESET OF THE CALIBRATION VALUES; if the value is outside $\pm 20\%$ FS, disassemble the sensor, check and clean the hole, mount again the sensor and re-do the CAL function 3 - If the zero is within $\pm 20\%$ FS, check cable and connector 4 - If the problem persists, send the sensor to factory for repair
The AUTOZERO function doesn't work	<ul style="list-style-type: none"> • Broken electronics • Zero signal outside activation range • Broken connector/cable (only external autozero version) • Wrong magnetic pen positioning 	<ul style="list-style-type: none"> 1 - Check the correct magnetic pen positioning on the autozero logo 2 - If the problem persists, stop the machine 3 - Make the TOTAL RESET OF THE CALIBRATION VALUES; if the value is outside $\pm 40\%$ FS, disassemble the sensor, check and clean the hole, mount again the sensor and re-do the AUTOZERO function 4 - If the zero is within $\pm 40\%$ FS, check cable and connector 5 - If the problem persists, send the sensor to factory for repair
Transmitter not communicating with HART communicator	<ul style="list-style-type: none"> • Broken electronics • HART communicator wrongly connected 	<ul style="list-style-type: none"> 4. Check Power Supply 5. Verify HART communicator connection 6. Verify 250 ohm series resistor
HART communicator does not display the entire device menu	<ul style="list-style-type: none"> • Broken electronics • HART communicator wrongly connected • HART communicator database (DD) not updated 	<ul style="list-style-type: none"> 5. Check Power Supply 6. Verify HART communicator connection 7. Verify 250 ohm series resistor 8. Verify HART communicator database

Tab. 10.3. Most common failures and troubleshooting

Application for use relevant to the designated category

The HMJ P/S, and HWJ P/S series transducer can be used in a pressure sensing chain in order to stop any pressure generating system if a pressure threshold is overcome.

The threshold is only set in factory and can't be changed by the user.

In diagram "A" (Fig. 10.2) is shown a possible application: the sensor detects the pressure and gives in output an analog electrical value proportional to the pressure itself; SRP/CS compares the signal with its internal alarm threshold: if the threshold is exceeded the SRP/CS will stop the pressure generation systems.

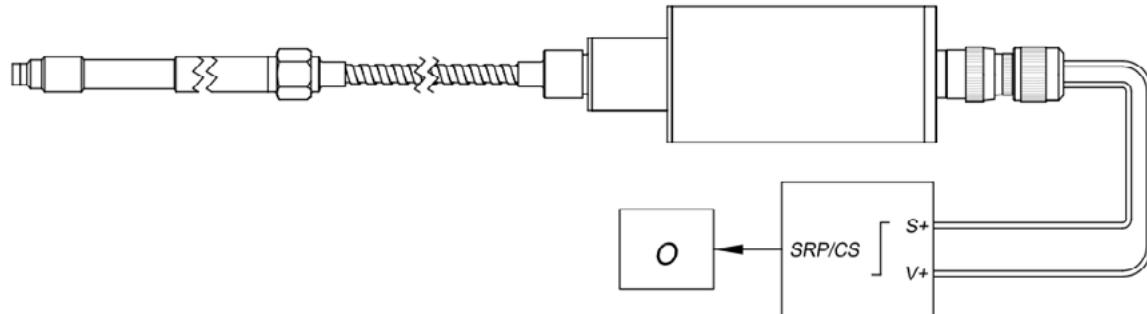


Fig. 10.2. Application diagram A - Current 2-wires output

11. SAFETY NOTES FOR APPLICATIONS IN POTENTIALLY EXPLOSIVE ATMOSPHERES

HMJ and HWJ series are designed and built according to:

- ATEX Directive 2014/34/EU, in conformity to EN IEC 60079-0:2018, EN 60079-1:2014, EN 60079-31:2014 (and EN IEC 60079-31:2024), see updated EU conformity declaration
- IECEx Scheme, in conformity to IEC 60079-0: 2017, IEC 60079-1:2014 and IEC 60079-31:2022
- Nepsi Ex regulation according to
GB/T 3836.1-2021,GB/T 3836.2-2021,GB/T 3836.4-2021,GB/T 3836.31-2021



Type of protection:

group II, category 2G, 2D (EPL Gb/Db)

Gas type of protection: Ex db IIC T6/T5 Gb

Dust type of protection: Ex db IIIC T6/T5 Db

Ambient Temperature: -20°C/+60°C (T6) and -20°C/+85°C (T5)

The HMJ and HWJ series Melt pressure transmitter must be installed and serviced in conformity to plant engineering and maintenance standards for environments classified at risk of explosion due to the presence of gases (example: EN 60079-14, EN 60079-17 or other national standards) and dust.

Please avoid any dust accumulation on the transmitter.

The installer has to ensure that the process temperature does not make the ambient temperature to exceed the maximum surface temperature specified on the label.

The user has to connect the free extremity of cable either in non-explosive atmosphere or in an enclosure protected by a recognized type of protection, according to EN 60079-14.

The device shall be grounded to the machine through the thread of contact diaphragm

The AUTOZERO procedure must be run by means of the transmitters pen by short circuiting the CAL lines as shown in the following figures or by means of HART control.

The CAL procedure must be run by short circuiting the leads directly on the cable or on the connection terminals.

See further details on the safety notes

11.1. Nepsi Ex requirements

一、产品安全使用特殊条件

产品防爆合格证号后缀“X”表示产品有安全使用特殊要求，具体内容如下：

1、安装人员必须确保工艺温度不会使环境温度超过标签上指定的最大值。

-HMJ2、HNJ2、HWJ2型号包括一个单独的热电偶，需要由具有电流分离的本安型相关设备提供，参数如下： $Ui = 30V, li = 100mA, Pi = 0.75W, Li = 0, Ci = 0$ 。

2、产品使用环境温度：-20°C~ +60°C (T6) ， -20°C~ +85°C (T5) 。

二、产品使用注意事项

1、产品外壳设有接地端子，用户在安装使用时应可靠接地。

2、产品电气参数：额定电压：13–30 Vdc，最大电流：23mA，功耗： <1 W。

HMJ2、HNJ2、HWJ2型号包括一个单独的热电偶，本安参数见产品安全使用特殊条件。

3、产品外壳防护等级：IP67（符合GB/T 4208-2017）。


4、产品在现场使用和维护时必须遵守“危险场所严禁开盖”的原则。

5、用户不得自行随意更换该产品的电气零部件，应会同产品制造商共同解决运行中出现的故障，以免影响防爆性能和损坏现象的发生。

6、产品的安装、使用和维护应同时遵守产品说明书、GB/T 3836.13–2021“爆炸性环境 第13部分：设备的修理、检修、修复和改造”、GB 3836.15-2024“爆炸性环境 第15部分：电气装置的设计、选型、安装规范”、GB 3836.16-2024“爆炸性环境 第16部分：电气装置检查和维护规范”、GB15577-2018“粉尘防爆安全规程”和GB50257-2014“电气装置安装工程爆炸和火灾危险环境 电气装置施工及验收规范”的有关规定。

11.2. Mounting Instructions For Installations In Dangerous Zones

Based on the application, HMJ and HWJ series Melt pressure transmitters must be installed according to the instructions in Fig. 11.1

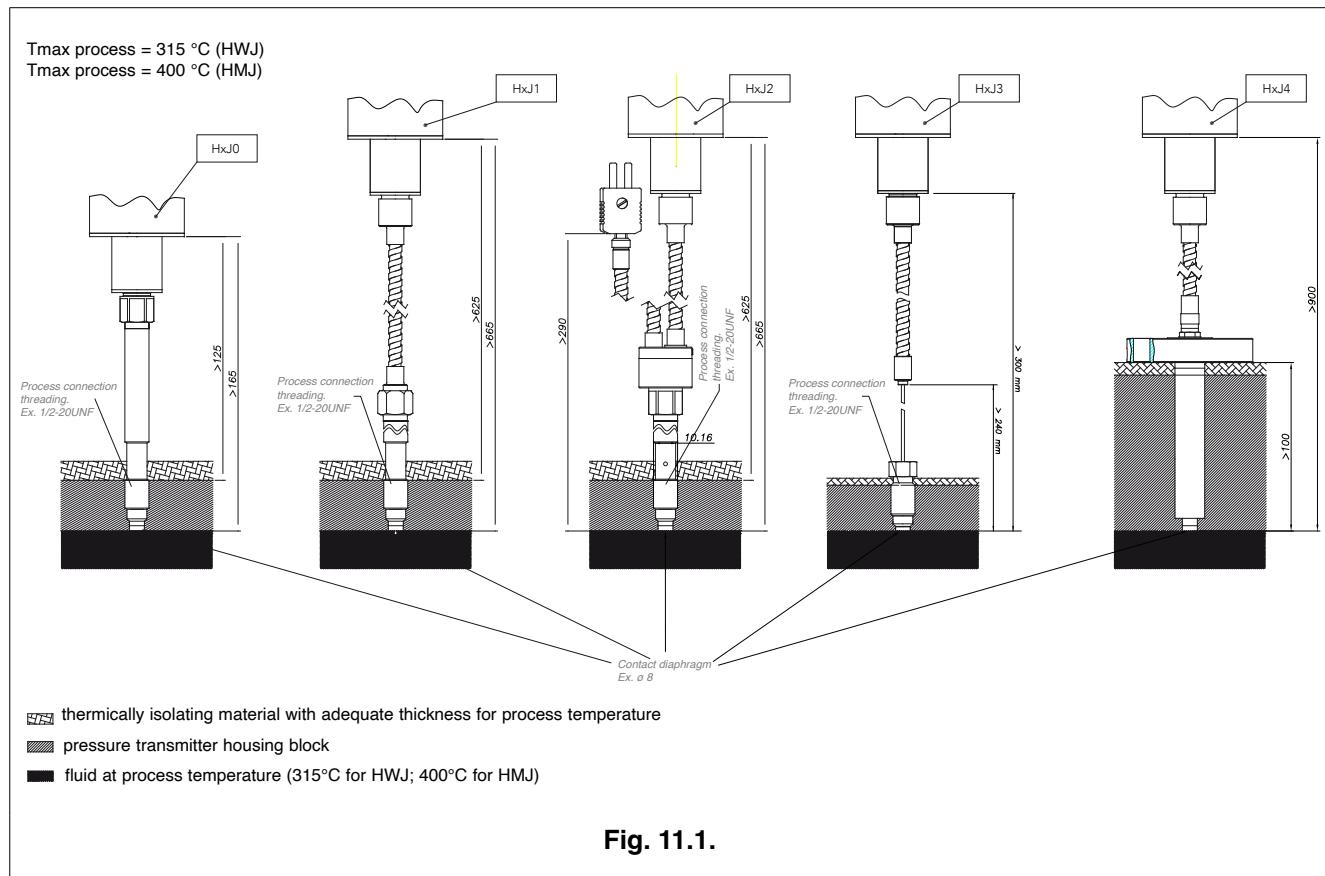

12. ANNEXES

Annex 1 - Hg TOXICOLOGICAL SHEET

1 - ELEMENTS IDENTIFYING SUBSTANCE OR PREPARATION AND COMPANY	Product data	
	• Molecular formula:	Hg
	• Structura formula:	Hg
	• Commercial name:	Mercury
	• SDS N°:	CH0349
2 - COMPOSITION/ INFORMATION ON INGREDIENTS	• Information supplied by:	E.S. & Q. A
	• Chemical characteristics:	CAS number 7439-97-6 mercury
3 - INDICATION OF HAZARDS	• Identification number/s:	EINECS number: 2311067 CEE number: 080-001-00-0
	• Classification of hazard:	T Toxic N Hazardous for the environment
4 - FIRST AID	• Indications of specific hazards for humans and the environment:	R 23 Toxic if inhaled R 33 Danger of cumulative effects R 50/53 Highly toxic for sea life, may cause long-term negative effects on the aquatic environment.
	• General instructions:	Immediately remove clothing contaminated with product. Remove protective mask only after removing contaminated clothing. In case of irregular breathing or breathing failure, apply artificial respiration.
	• Inhalation:	Take the victim to a well-ventilated area and administer oxygen. CALL A DOCTOR. If the victim has fainted, try to keep him in a stable position on his side as you move him.
	• Contact with skin:	Wash immediately with soap and water, rinse thoroughly.
	• Contact with eyes:	Wash with running water for several minutes, keeping the eyelids wide open. CALL A DOCTOR.
	• Ingestion:	Call a doctor if victim feels ill.
5 - FIRE PREVENTION MEASURES	• Approved fire extinguishers:	CO ₂ , powder or nebulized water. Extinguish large fires with nebulized water or alcohol-resistant foam.
	• Specific risks due to the substances, its combustion products, or released gases:	If heated or in case of fire, the product may generate toxic fumes. Fumes contain metal oxides.
	• Specific means of protection:	Wear an all-service mask in closed rooms.
6 - MEASURES IN CASE OF ACCIDENTAL SPILL	• Measures to protect people:	In case of vapors/dust/aerosol, use respiratory protections
	• Measures to protect environment:	In case of infiltration in bodies of water or sewers, notify the competent authorities. Prevent filtration in sewers/surface waters/groundwater.
	• Cleaning/absorption methods:	Aspirate liquid in suitable container and absorb the rest with porous material (tripoli, acid binder, universal binder, etc.) Dispose of contaminated material in conformity to point 13. Ventilate the area completely.

7 - HANDLING AND STORAGE	Handling • Instructions for safe handling:	Keep containers hermetically sealed. Good ventilation/aspiration in workplaces. Open and handle containers with care. Avoid formation of aerosol.
	• Instructions for preventing fires and explosions:	Keep all-service mask handy
	Storage • Requirements for warehouses and containers:	Provide floor tank without discharge.
	• Instructions for mixed storage:	Non necessary.
	• Additional instructions regarding storage conditions:	Keep containers hermetically sealed.
	Storage class: • Class VbF (ordinance regarding combustible substances):	Not applicable
8 - EXPOSURE CONTROL/PERSONAL PROTECTION	Additional instructions regarding structure of technical systems:	No additional data. See point 7
	• Component whose limits must be kept under control in workplaces:	Mercury TLV: 0,025 mg/m ³
	• Additional instructions:	Lists valid on the date of compilation were used as basis
	Means of personal protection • General rules for protection and hygiene at the workplace:	Keep away from food, drink, and forage. Immediately remove contaminated clothing. Wash hands before taking a break and at end of shift. Store protective gear separately.
	• Protective mask:	Use the mask in case of brief, slight exposure; for heavier and longerexposure, wear a self-contained breathing apparatus. Use all-service mask only in case of formation of aerosol or mist.
	• Protective gloves:	Neoprene gloves.
	• Goggles:	Wear goggles while pouring.
9 - PHYSICAL AND CHEMICAL PROPERTIES	• Molecular weight:	200,59 g
	• Form:	Liquid
	• Color:	Silver
	• Odor:	None
	Unit value/Method • Change of state	
	• Melting temperature:	-38,86°C
	• Boiling temperature:	356,73°C
	• Flash point:	not applicable
	• Danger of explosion:	product not explosive
	• Vapor voltage:	a 20°C 0,00163 hPa
	• Density:	a 20°C 13,54 g/cm ³
	• Solubility in/Mixability with water:	slightly and/or not mixable
	• Organic solvents:	insoluble
10 - STABILITY AND REACTIVITY	• Thermal decomposition/conditions to be avoided:	the product does not decompose if correctly used.
	• Substances to be avoided:	Acetylene
	• Hazardous reactions:	Reactions with peroxides and other substances forming radicals. Decomposition of hydrogen peroxide.
	• Hazardous products of decomposition:	No hazardous products of decomposition are known

11 - TOXICOLOGICAL INFORMATION	• Acute toxicity:	Significant LD/LC50 values for classification: Mercury. For inhalation: LC50: (30h) 0,03 mg/l (rabbit)
	• Primary irritability:	- On the skin: has no irritating effects. - In the eyes: not particularly irritating. - Sensitization: no sensitizing effects are known
	• Subacute to chronic toxicity:	Cumulative effects in case of repeated exposure.
12 - ECOLOGICAL INFORMATION	• Behavior in ecological context	-
	• Mobility and potential of bioaccumulation:	possible biomethylation
	• Toxic effects on environment:	Aquatic toxicity: Mercury LC50 aq.: (Hg++ 96h) 0,06 mg/l (daphnia)
	• Additional information:	Hazard for class 3 waters (WGK German) (Classif. on lists): very hazardous. Do not put in groundwater, rivers, or sewers, even in small doses. Hazard for drinking water even in case of minimum leaks of product in subsoil. Toxic for fish and plankton.
13 - INFORMATION ON DISPOSAL	Product • Recommendations:	Do not dispose of the product together with domestic waste. Do not put in sewers. Recycle if possible; otherwise, contact a company authorized to dispose of industrial waste.
	• Soiled packing: • Recommendations:	Dispose of in conformity to government regulations. Wash with water to be purified and disposed of.
14 - INFORMATION ON TRANSPORT	Road/rail transport ADR/RID (beyond border) • ADR/RID-GGVS/E Class:	8 corrosive substances
	• Number/letter:	66c
	• Kemler number:	80
	• ONU number:	2809
	• Description of brand:	2809 Mercury
	Sea transport IMDG • IMDG Class:	8
	• Page:	8191
	• ONU number:	2809
	• Packing group:	III
	• EMS number:	8-12
	• MFAG:	-
	• Exact technical name:	Mercury
	Air transport ICAO-TI and IATA-DGR • ICAO/IATA Class:	8
	• ONU/ID number:	2809
	• Packing group:	III
	• Exact technical name:	Mercury

15 - INFORMATION ON REGULATIONS	• Classification according to CE directives:	The product is classified and coded in conformity to CE directives/rules on hazardous products / dir. 67/548 25° update / dir. 88/379 4° update
	• Label code for product hazardousness:	T Toxic N Hazardous for the environment
	• Nature of specific risks (R phrases):	23 Toxic if inhaled 33 Danger of cumulative effects 50/53 Highly toxic for aquatic organisms, may cause long-term negative effects on the aquatic environment.
	• Recommendations of prudence (S phrases):	7 Keep container completely closed 45 In case of accident or malaise, call a doctor immediately (if possible, show him/her the label) 60 This material and its container must be disposed of as hazardous waste 61 Dispose of properly. See the special instructions / data sheet on safety
	National regulations: • Classification according to VbF:	Not applicable
	National regulations: • Class of hazardousness for waters:	Hazard for class 3 waters (WGK3) (Classif. on lists): very hazardous. Additional regulations, limitations and prohibitive decrees: Maximum concentration in waste water (DPR 319/76 - Merli Law): 0,005 mg/l
	- The above data are based on our current knowledge. Nevertheless, they do not represent any guarantee of product characteristics and are not the basis for any legal and/or contractual relationship.	
16 - OTHER INFORMATION	• Data sheet issued by:	E.S. & Q. A.
	• Conatct:	Emergency Ph. 0039 2 95231
	• Bibliographic references:	ECDIN (Environmental Chem. Data and Information Network) IUCLID (International Uniform Chemical Information Database) NIOSH – Registry of Toxic Effects of Chemical Substances Roth –Wassergefährdende Stoffe Verschueren – Handbook of Environmental Data on Organic Chemicals ChemDAT – Safety Data Sheets from E.Merck on CD-ROM Merian – Metals and their compounds in the environment.

GEFRAN

GEFRAN spa

via Sebina, 74 - 25050 Provaglio d'Iseo (BS) - ITALIA - Tel. +39 0309888.1 - Fax +39 0309839063
www.gefran.com - www.gefranonline.com