



Main features:

- Measurements up to 4000bar nozzle pressure and melt temperature of 400°C.
- Multishot measurements at temperatures <230°C with different levels of pressure.
- Simple magnetic installation without screws.
- Combine the IN Sensor together with the Nozzle touch force sensor.
- Ideal for service and development (measurements during operation are not possible).
- Scope of delivery: IN Sensor, Controle and display device, Heater band, Nozzle adapter, Magnetic adapter, Magnetic base and carrying case.



The IN-4000 SET measures in the injection moulding machine the nozzle pressure compare to the injection pressure. This is especially important in processes according to ISO9000. The Nozzle pressure sensor is mounted with magnetic force.

The nozzle injector of the injection moulding machine press directly on the nozzle adapter which protects the sensor against damage. After that the IN Sensor will be loaded with the melt of the injection pressure. The Heater band warms the Sensor up to 230°C so that the melt in the conical chamber remains liquide. This allows multiple measurements with different injection pressure.

TECHNICAL DATA


Strain gauge type	Foil
Measuring range	4000bar
Maximum touch force	300kN (@ 60 mm diameter)
Sensitivity	1.5 mV/V (nominal)
Accuracy Error	< ± 0.5% FS
Linearity Error	< 0.2% FS
Repeatability Error	< 0.2% FS
Operating temperatur range	10°...+230°C (up to 400°C with singleshot application)
Storage temperatur range	-20°...+70°C
Protection class	IP50
Case material	Stainless steel (high grade)

APPLICATION

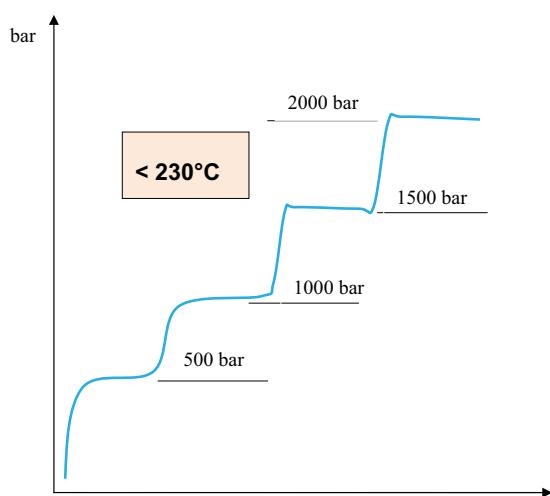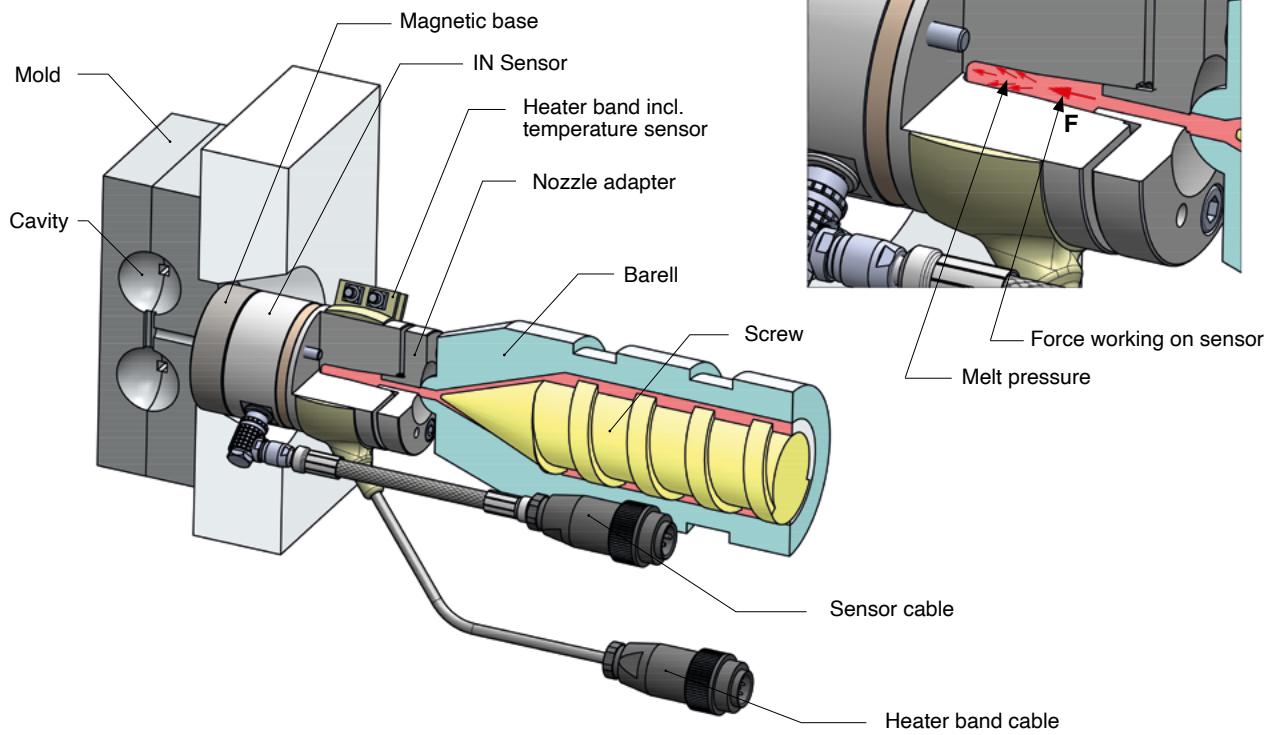

MULTISHOT

- Measure melt pressures up to 230°C and 4000bar
- Plastic does NOT solidify during pressure steps
- Nozzle pressure is transmitted through plastic onto the measuring element

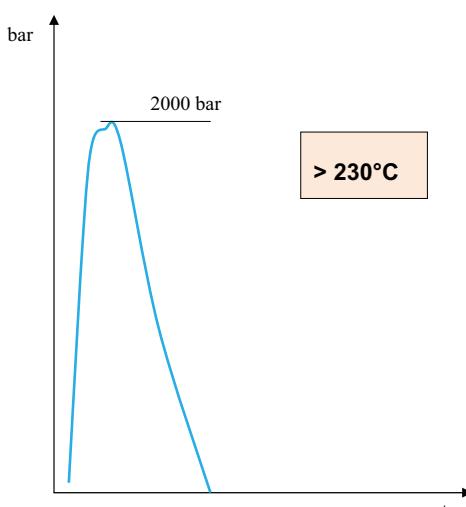


SINGLESHTOT


- For melt temperatures > 230°C (up to 400°C)
- One shot only, then solidification
- Plastic has to be removed every shot

DIMENSION

IN Sensor

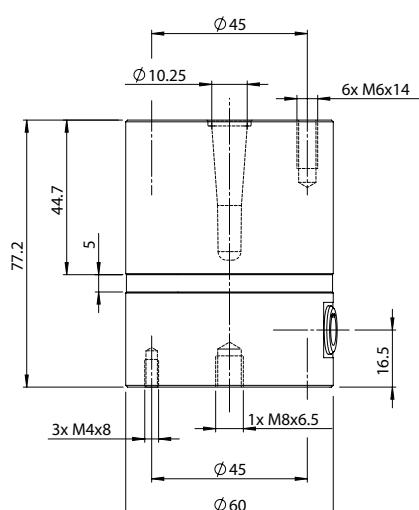


Example: Assembly drawing

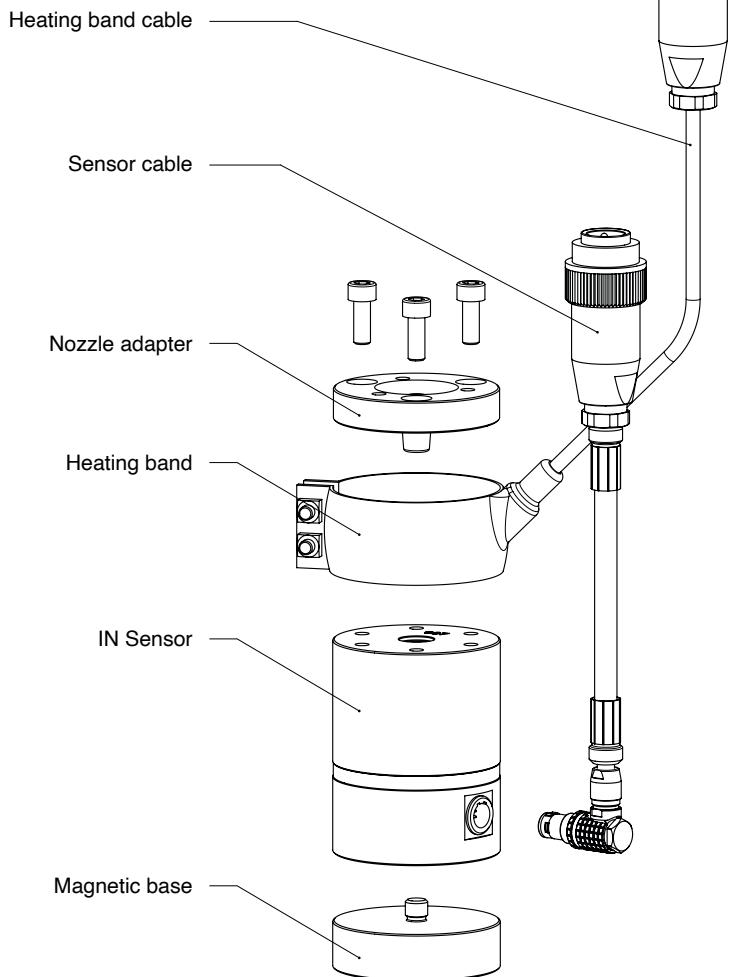

Dimensions in mm


Monitor

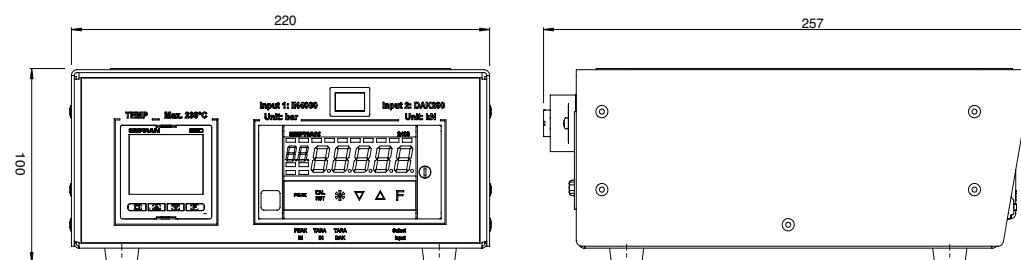

Temperature controller
(max. 230°C)

Switch: Input channel

Monitor:
- for Nozzle Pressure (IN)
- for Nozzle Touch Force (DAK)

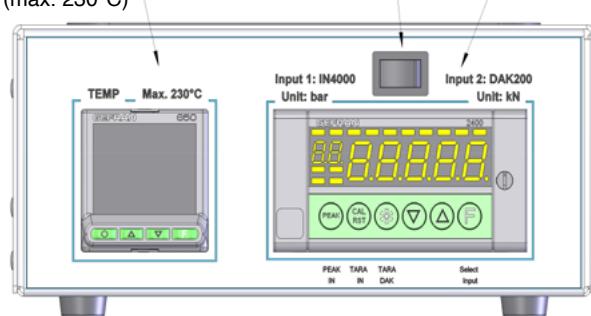

Dimensions in mm

ASSESSORIES


Nozzle adapter NA-IN-3

(1 piece included in the case)

The nozzle adapter protects the IN Sensor and the tip of the nozzle can be optimally adapted.

The nozzle adapter is by the customers themselves adapted to the respective nozzle tip of the injection molding machine.


The raw diameter is 3mm.

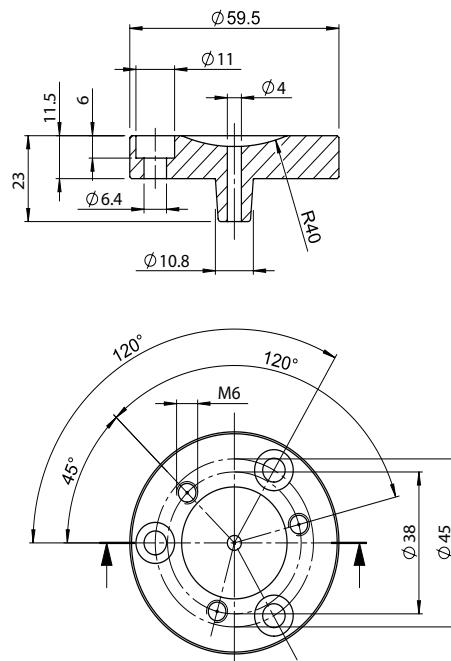

Dimensions in mm

Magnetic base „S“ 60mm

The magnetic base with Ø 60mm contains 1 magnet.

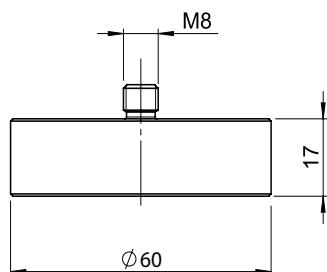


Dimensions in mm

Magnetic base „H“ 100mm


The magnetic base with Ø 100mm contains 3 magnets.

Three screws M6 helps to remove the magnetic base from the machine.

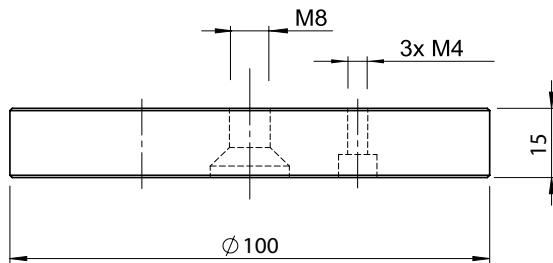

Dimensions in mm

Centering disc set

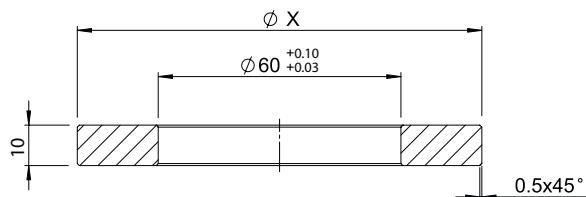


The set (F086992) contains

	Ø X -0.05 / -0.15
1 piece	80
1 piece	90
1 piece	100



Dimensions in mm

ELECTRICAL CONNECTIONS

Monitor


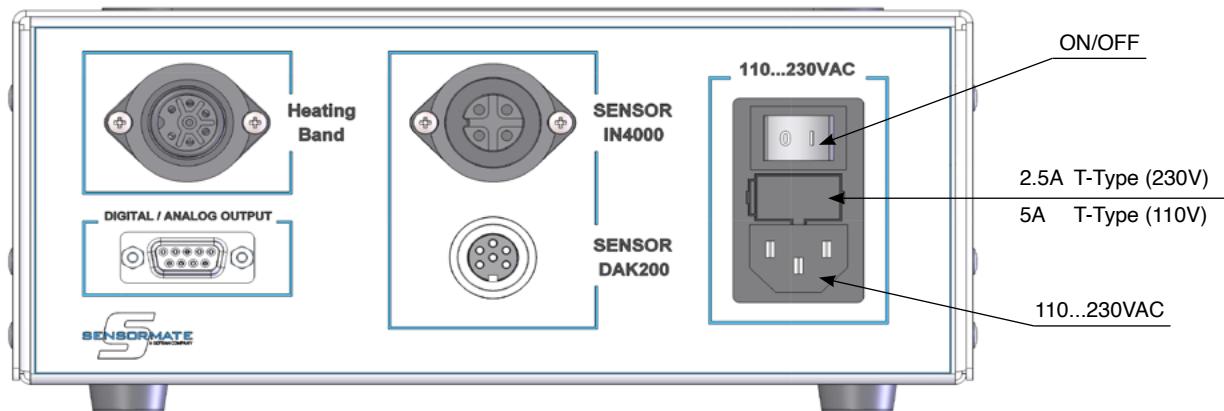


IN sensor input

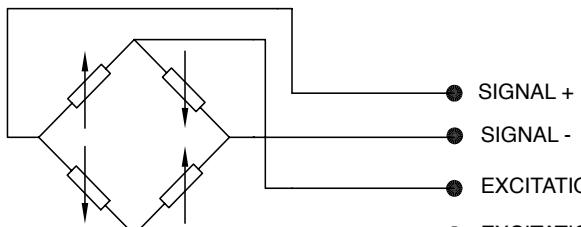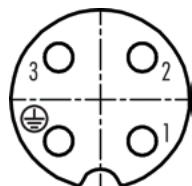

CONNECTOR	
2	
3	
1	
4	

DAK sensor input

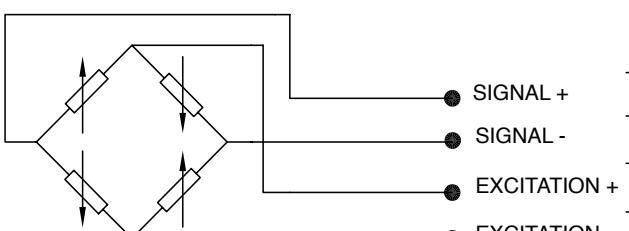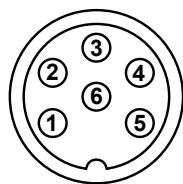

CONNECTOR	
4	
5	
1-2	
3-6	

ORDER CODE

Nozzle pressure sensor	IN -	<input type="text"/>	<input type="text"/>	<input type="text"/>	-	<input type="text"/>	-	<input type="text"/>	<input type="text"/>	-	<input type="text"/>	-	<input type="text"/>	
Measuring range														
4000 bar		4000												
IN Sensor external diameter														
60 mm		S												
Connector and cable														
Cable length 3m		C30												
Magnetic base														
External diameter 60 mm		S												
External diameter 100 mm		H												
Monitor														
Monitor standard		M												
Monitor with digital output		D												
Heat band														
110VAC		1												
230VAC		2												
110VAC + 230VAC (two heat bands)		3												

Example: IN - 4000 - S - C30 - S - M - 2
 IN Sensor, Measuring range 4000bar, IN Sensor external diameter 60 mm, Cable 3m, Magnetic base 60mm, Monitor standard, Heat band for 230VAC

ACCESSORIES

Description	Order code	Code
Single sensor without cable	IN - 4000 - S - C00 - O - O - 0	F089030
Single cable	IN - 0000 - O - C30 - O - O - 0	F083322
Nozzle adapter type NA-IN-3	NA-IN-3	F086990
Monitor standard	IN - 0000 - O - 000 - O - M - 0	F063416
Monitor with digital output	IN - 0000 - O - 000 - O - D - 0	F069660
Magnetic base 60mm	IN - 0000 - O - 000 - S - O - 0	F068444
Magnetic base 100mm	IN - 0000 - O - 000 - H - O - 0	F069015
Centering disc set	CD - IN - 080 - 090 - 100	F086992
Heat band 110VAC	IN - 0000 - O - 000 - O - O - 1	F065947
Heat band 230VAC	IN - 0000 - O - 000 - O - O - 2	F062424
Heat band 110VAC + 230VAC (two heat bands)	IN - 0000 - O - 000 - O - O - 3	F069659

GEFRAN spa reserves the right to make any kind of design or functional modification at any moment without prior notice.

GEFRAN

GEFRAN spa
 via Sebina, 74 - 25050 Provaglio d'Iseo
 (BS) - ITALIEN
 Tel.: +39 030 9888.1 - Fax: +39 030 9839063
 Internet: www.gefran.com

Gefran Schweiz AG
 Steigweg 8, - CH-8355 Aadorf, Schweiz
 Tel.: +41 52 523 25 00
 Fax: +41(0)52-3661884
 Internet: www.gefran.com

DTS_IN-4000 SET_06-2025_ENG