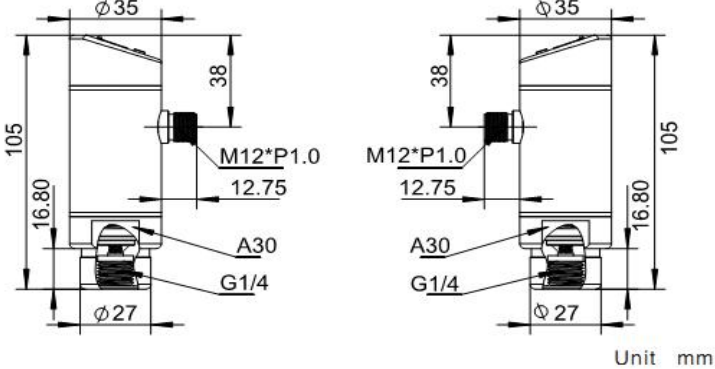
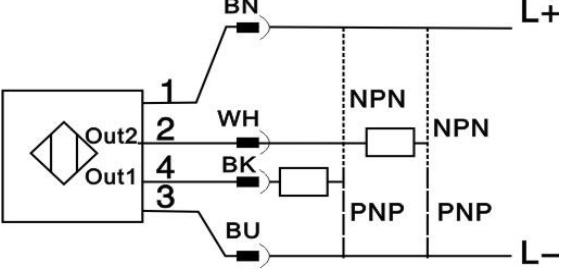



PE4110 Ex-Proof mbar Pressure Sensor M12 socket Connection: Internal thread G1/4" Programmable Dual Switching output 4 digit display Sensing range -100...100 mbar -1.45...1.45 Psi -0.1...0.1 kgf/cm2	   
Ex-Proof classification	Ex nA IIC T4 Gc / Ex tD A21 IP67 T90°C
Applications	Corresponding pressure Liquid and Air
Electric design	DC PNP / NPN
Output	 NO/  NC
Supply voltage[V]	20...32DC
Short-circuit protection	Pulsed
Reverse polarity protection	Yes
Overload protection	Yes
Watchdog	Yes
Voltage drop[V]	<2
Current consumption[mA]	<60
Overloading Pressure [bar]	1.0
Burst pressure [bar]	1.3
Analogue output OUT2	NPN/PNP
Overload of analogue output[Ohm]	300
Switching output OUT1	NPN/PNP
Overload of switching output [mA]	300
Setting range	
Switching point (SP)	-100...100 mbar
Reset point (rP)	-100...99 mbar
In steps of	1 mbar
Programming options	Hysteresis range / Window function; NO / NC; Calibration; Unit display; Output 2 setting: NPN / PNP output; Output 1 setting: NPN / PNP output
Deviations (% of final value measured)	
Accuracy of switching point	±(0.2...0.5)
Characteristic deviation	< ±0.5
Hysteresis	< ±0.25
Stability of long-time use	< ±0.5
Ambient temperature [°C/°F]	-25...70/-13...158
Medium temperature [°C/°F]	-25...70/-13...158 When used for non-explosive area: -25...80/-13...176
Storage temperature[°C/°F]	-40...100/-40...212
Protection/Enclosure Rating	IP67

Insulation resistance[MΩ]	> 100(500 V DC)
Dimension	
ESD	6kV
EFT	2kV
Walkie talkie experiment[mm]	<10
Shock resistance[g]	50
Vibration resistance[g]	20
Housing material	Stainless steel 304
Probe material/Wetted Parts	Stainless steel 316L
Medium contacting material	Ceramic/Stainless steel 316L/FKM
Function Display	
Switching status LED	2 red LED
System pressure/Function LED	4 digit segment
Connection	M12 socket
Wiring	
Core color	
	
Installation notice	Use the wrench to tighten Ex-proof connector with 1.5Nm of torque